

Operating Instructions

Pressure sensor with ceramic measuring cell

VEGABAR 28

Three-wire with IO-Link (2 x transistor or 4 ... 20 mA plus 1 x transistor)



Document ID: 57541



VEGA

Contents

| | | |
|-----------|--|-----------|
| 1 | About this document | 4 |
| 1.1 | Function | 4 |
| 1.2 | Target group | 4 |
| 1.3 | Symbols used..... | 4 |
| 2 | For your safety | 5 |
| 2.1 | Authorised personnel | 5 |
| 2.2 | Appropriate use..... | 5 |
| 2.3 | Warning about incorrect use..... | 5 |
| 2.4 | General safety instructions | 5 |
| 2.5 | Installation and operation in the USA and Canada | 5 |
| 3 | Product description | 7 |
| 3.1 | Configuration..... | 7 |
| 3.2 | Principle of operation..... | 9 |
| 3.3 | Adjustment | 11 |
| 3.4 | Packaging, transport and storage..... | 12 |
| 3.5 | Accessories..... | 13 |
| 4 | Mounting | 14 |
| 4.1 | General instructions | 14 |
| 4.2 | Process pressure measurement..... | 16 |
| 4.3 | Level measurement..... | 18 |
| 5 | Connecting to power supply | 19 |
| 5.1 | Preparing the connection | 19 |
| 5.2 | Connection procedure..... | 19 |
| 5.3 | Wiring plan | 20 |
| 5.4 | Switch-on phase..... | 20 |
| 6 | Access protection | 21 |
| 6.1 | Bluetooth radio interface | 21 |
| 6.2 | Protection of the parameterization..... | 21 |
| 6.3 | Storing the codes in myVEGA | 22 |
| 7 | Setup with smartphone/tablet (Bluetooth) | 23 |
| 7.1 | Preparations..... | 23 |
| 7.2 | Connecting..... | 23 |
| 7.3 | Sensor parameter adjustment..... | 24 |
| 8 | Setup with PC/notebook (Bluetooth) | 25 |
| 8.1 | Preparations..... | 25 |
| 8.2 | Connecting..... | 25 |
| 8.3 | Parameter adjustment | 26 |
| 9 | Menu overview | 27 |
| 9.1 | VEGA Tools app and DTM (Bluetooth) | 27 |
| 10 | Diagnostics and servicing | 30 |
| 10.1 | Maintenance | 30 |
| 10.2 | Rectify faults..... | 30 |
| 10.3 | Diagnosis, fault messages | 31 |
| 10.4 | Status messages according to NE 107 | 32 |

| | | |
|-----------|--|-----------|
| 10.5 | Software update | 34 |
| 10.6 | How to proceed if a repair is necessary..... | 34 |
| 11 | Dismount..... | 35 |
| 11.1 | Dismounting steps..... | 35 |
| 11.2 | Disposal | 35 |
| 12 | Certificates and approvals | 36 |
| 12.1 | Radio licenses..... | 36 |
| 12.2 | Approvals for Ex areas | 36 |
| 12.3 | Ship approvals | 36 |
| 12.4 | Food and pharmaceutical certificates..... | 36 |
| 12.5 | Conformity..... | 36 |
| 12.6 | NAMUR recommendations | 36 |
| 12.7 | Environment management system | 37 |
| 13 | Supplement | 38 |
| 13.1 | Technical data | 38 |
| 13.2 | Device communication IO-Link..... | 46 |
| 13.3 | Dimensions | 52 |
| 13.4 | Industrial property rights..... | 57 |
| 13.5 | Licensing information for open source software | 57 |
| 13.6 | Trademark..... | 57 |



Safety instructions for Ex areas:

Take note of the Ex specific safety instructions for Ex applications. These instructions are attached as documents to each instrument with Ex approval and are part of the operating instructions.

Editing status: 2022-08-25

1 About this document

1.1 Function

This instruction provides all the information you need for mounting, connection and setup as well as important instructions for maintenance, fault rectification, the exchange of parts and the safety of the user. Please read this information before putting the instrument into operation and keep this manual accessible in the immediate vicinity of the device.

1.2 Target group

This operating instructions manual is directed to trained personnel. The contents of this manual must be made available to the qualified personnel and implemented.

1.3 Symbols used



Document ID

This symbol on the front page of this instruction refers to the Document ID. By entering the Document ID on www.vega.com you will reach the document download.



Information, note, tip: This symbol indicates helpful additional information and tips for successful work.



Note: This symbol indicates notes to prevent failures, malfunctions, damage to devices or plants.



Caution: Non-observance of the information marked with this symbol may result in personal injury.



Warning: Non-observance of the information marked with this symbol may result in serious or fatal personal injury.



Danger: Non-observance of the information marked with this symbol results in serious or fatal personal injury.



Ex applications

This symbol indicates special instructions for Ex applications.



List

The dot set in front indicates a list with no implied sequence.



Sequence of actions

Numbers set in front indicate successive steps in a procedure.



Disposal

This symbol indicates special instructions for disposal.

2 For your safety

2.1 Authorised personnel

All operations described in this documentation must be carried out only by trained, qualified personnel authorised by the plant operator.

During work on and with the device, the required personal protective equipment must always be worn.

2.2 Appropriate use

The VEGABAR 28 is a pressure transmitter for process pressure and hydrostatic level measurement.

You can find detailed information about the area of application in chapter " *Product description*".

Operational reliability is ensured only if the instrument is properly used according to the specifications in the operating instructions manual as well as possible supplementary instructions.

2.3 Warning about incorrect use

Inappropriate or incorrect use of this product can give rise to application-specific hazards, e.g. vessel overfill through incorrect mounting or adjustment. Damage to property and persons or environmental contamination can result. Also, the protective characteristics of the instrument can be impaired.

2.4 General safety instructions

This is a state-of-the-art instrument complying with all prevailing regulations and directives. The instrument must only be operated in a technically flawless and reliable condition. The operator is responsible for the trouble-free operation of the instrument. When measuring aggressive or corrosive media that can cause a dangerous situation if the instrument malfunctions, the operator has to implement suitable measures to make sure the instrument is functioning properly.

The safety instructions in this operating instructions manual, the national installation standards as well as the valid safety regulations and accident prevention rules must be observed by the user.

For safety and warranty reasons, any invasive work on the device beyond that described in the operating instructions manual may be carried out only by personnel authorised by the manufacturer. Arbitrary conversions or modifications are explicitly forbidden. For safety reasons, only the accessory specified by the manufacturer must be used.

To avoid any danger, the safety approval markings and safety tips on the device must also be observed.

2.5 Installation and operation in the USA and Canada

This information is only valid for USA and Canada. Hence the following text is only available in the English language.

Installations in the US shall comply with the relevant requirements of the National Electrical Code (ANSI/NFPA 70).

Installations in Canada shall comply with the relevant requirements of the Canadian Electrical Code.

3 Product description

3.1 Configuration

Scope of delivery

The scope of delivery encompasses:

- VEGABAR 28 pressure transmitter
- Information sheet "*Documents and software*" with:
 - Instrument serial number
 - QR code with link for direct scanning
- Information sheet "*PINs and Codes*" (with Bluetooth versions) with:
 - Bluetooth access code
- Information sheet "*Access protection*" (with Bluetooth versions) with:
 - Bluetooth access code
 - Emergency Bluetooth unlock code
 - Emergency device code

The further scope of delivery encompasses:

- Documentation
 - Quick setup guide VEGABAR 28
 - Ex-specific "*Safety instructions*" (with Ex versions)
 - Radio approvals (versions with Bluetooth)
 - If necessary, further certificates



Note:

Optional instrument features are also described in this operating instructions manual. The respective scope of delivery results from the order specification.

Scope of this operating instructions

This operating instructions manual applies to the following instrument versions:

- Hardware version from 1.0.0
- Software version from 1.3.0

Constituent parts

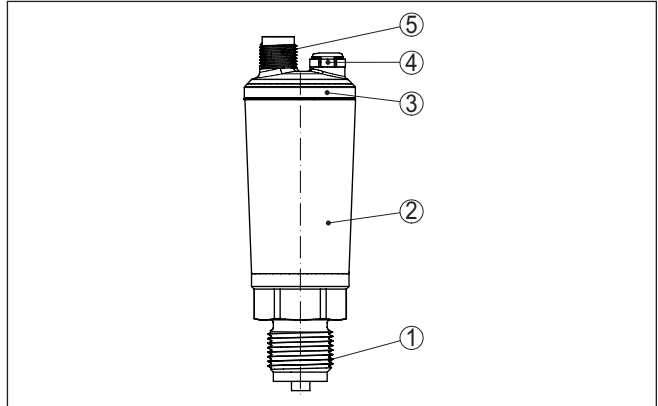


Fig. 1: Components of VEGABAR 28

- 1 Process fitting
- 2 Electronics housing
- 3 LED illuminated ring
- 4 Ventilation/pressure compensation
- 5 Plug connector

Type label

The type label contains the most important data for identification and use of the instrument.

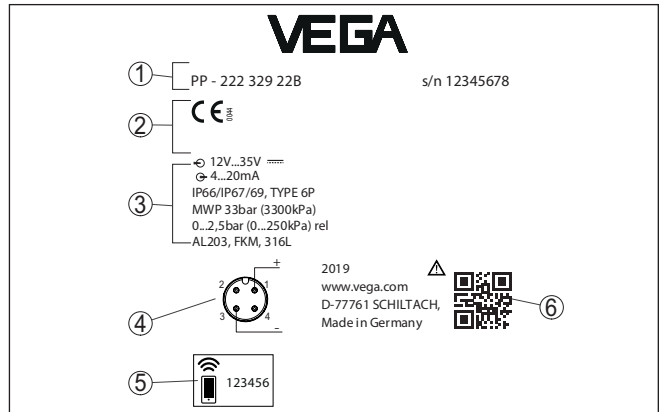


Fig. 2: Layout of the type label (example)

- 1 Order/Serial number
- 2 Field for approvals
- 3 Technical data
- 4 Assignment
- 5 Bluetooth access code
- 6 QR code for device documentation

Documents and software Move to "www.vega.com" and enter in the search field the serial number of your instrument.

There you can find the following information about the instrument:

- Order data
- Documentation
- Software

Alternatively, you can find all via your smartphone:

- Scan the QR-code on the type label of the device or
- Enter serial number manually in the VEGA Tools app (available free of charge in the respective stores)

3.2 Principle of operation

Application area

VEGABAR 28 is suitable for applications in virtually all industries. It is used for the measurement of the following pressure types.

- Gauge pressure
- Absolute pressure
- Vacuum

Measured products

Measured products are gases, vapours and liquids.

Depending on the process fitting and measurement setup, measured products can be also viscous or contain abrasive substances.

Measured variables

The VEGABAR 28 is suitable for the measurement of the following process variables:

- Process pressure
- Level

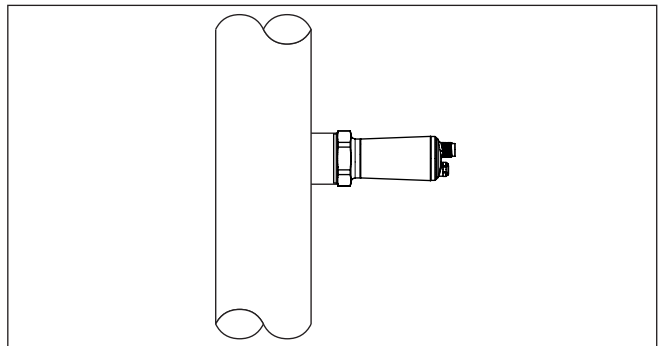


Fig. 3: Process pressure measurement VEGABAR 28

Measuring system pressure

The sensor element is the Mini-CERTEC® measuring cell with robust ceramic diaphragm. The process pressure deflects the ceramic diaphragm and causes a capacitance change in the measuring cell. This capacitance change is converted into an electrical signal and outputted as measured value via the output signal.

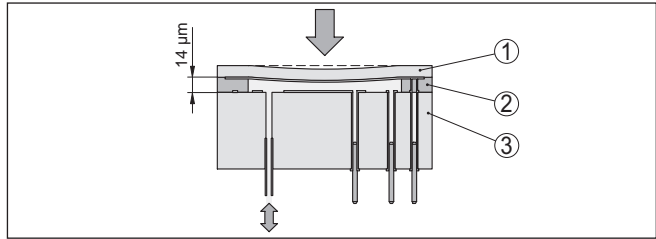


Fig. 4: Configuration of the Mini-CERTEC® measuring cell

- 1 Process diaphragm
- 2 Glass joint
- 3 Base element

Measuring system temperature

A temperature sensor in the electronics of the Mini-CERTEC® measuring cell measures the current process temperature. The temperature value is e.g. output via Bluetooth.

Pressure types

Relative pressure: the measuring cell is open to the atmosphere. The ambient pressure is detected in the measuring cell and compensated. It thus has no influence on the measured value.

Absolute pressure: the measuring cell contains vacuum and is encapsulated. The ambient pressure is not compensated and does hence influence the measured value.

Recessed installation

The recessed installation is particularly suitable for applications with gases, vapours and clear liquids. The measuring cell seals are positioned laterally as well as in front.

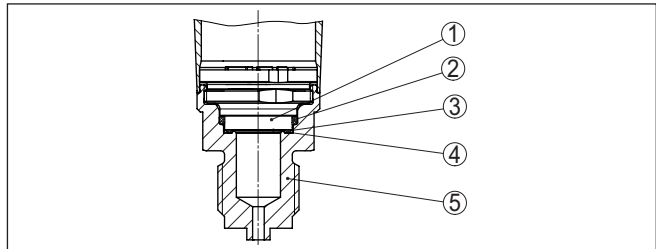


Fig. 5: Recessed installation of the measuring cell (example: manometer connection G½)

- 1 Measuring cell
- 2 Lateral measuring cell seal
- 3 Front measuring cell seal
- 4 Diaphragm
- 5 Process fitting

Front flush installation

The front-flush installation is particularly suitable for applications with viscous or abrasive media and for buildup.

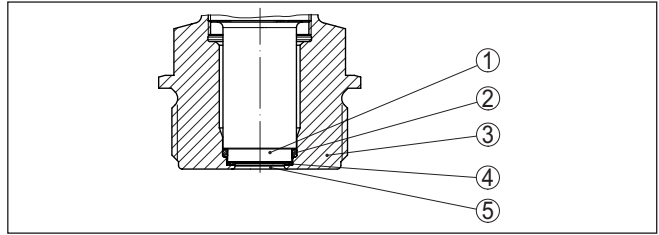


Fig. 6: Front-flush installation of the measuring cell (example: thread G1½)

- 1 Measuring cell
- 2 Lateral measuring cell seal
- 3 Front measuring cell seal
- 4 Process fitting
- 5 Diaphragm

Front-flush installation in hygienic fitting

The front-flush, hygienic installation of the measuring cell is particularly suitable for food applications. The front seal is installed gap-free.

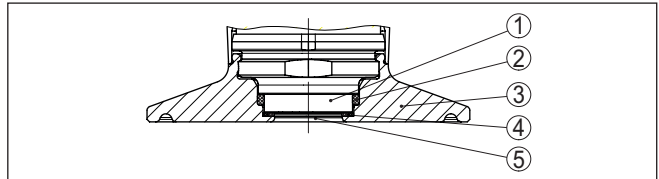


Fig. 7: Hygienic installation of the measuring cell (example: Clamp 2")

- 1 Measuring cell
- 2 Lateral measuring cell seal
- 3 Process fitting
- 4 Front measuring cell seal
- 5 Diaphragm

3.3 Adjustment

Wireless adjustment

Devices with integrated Bluetooth module can be adjusted wirelessly via standard adjustment tools: ¹⁾

- Smartphone/tablet (iOS or Android operating system)
- PC/notebook (Windows operating system)

1) Reduced effective range with M12 x 1 plug stainless steel (closed metal housing), see chapter "Technical Data"

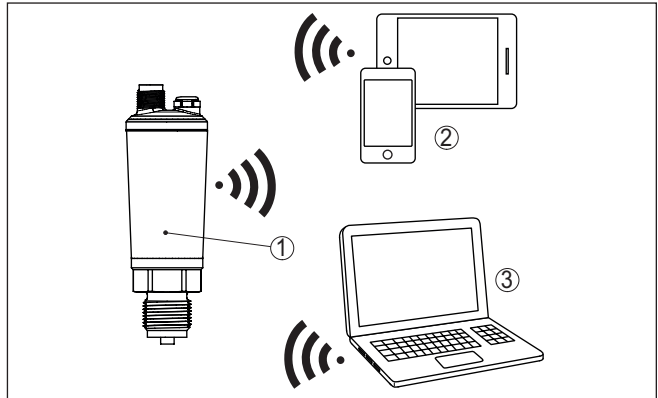


Fig. 8: Wireless connection to standard adjustment tools with integrated Bluetooth LE

- 1 Sensor
- 2 Smartphone/Tablet
- 3 Bluetooth USB adapter

3.4 Packaging, transport and storage

Packaging

Your instrument was protected by packaging during transport. Its capacity to handle normal loads during transport is assured by a test based on ISO 4180.

The packaging consists of environment-friendly, recyclable cardboard. For special versions, PE foam or PE foil is also used. Dispose of the packaging material via specialised recycling companies.

Transport

Transport must be carried out in due consideration of the notes on the transport packaging. Nonobservance of these instructions can cause damage to the device.

Transport inspection

The delivery must be checked for completeness and possible transit damage immediately at receipt. Ascertained transit damage or concealed defects must be appropriately dealt with.

Storage

Up to the time of installation, the packages must be left closed and stored according to the orientation and storage markings on the outside.

Unless otherwise indicated, the packages must be stored only under the following conditions:

- Not in the open
- Dry and dust free
- Not exposed to corrosive media
- Protected against solar radiation
- Avoiding mechanical shock and vibration
- Storage and transport temperature see chapter " *Supplement - Technical data - Ambient conditions*"

Storage and transport temperature

- Relative moisture 20 ... 85 %

3.5 Accessories

The instructions for the listed accessories can be found in the download area on our homepage.

Welded socket, threaded and hygienic adapter

Welded sockets are used to connect the devices to the process.

Threaded and hygienic adapters enable simple adaptation of devices with standard threaded fittings to process-side hygiene connections.

Mounting accessories

The suitable mounting accessories for VEGABAR 28 includes siphons, blocking valves and measuring instrument holders.

4 Mounting

4.1 General instructions

Ambient conditions

The instrument is suitable for standard and extended ambient conditions acc. to DIN/EN/IEC/ANSI/ISA/UL/CSA 61010-1. It can be used indoors as well as outdoors.

Process conditions



Note:

For safety reasons, the instrument must only be operated within the permissible process conditions. You can find detailed information on the process conditions in chapter " *Technical data*" of the operating instructions or on the type label.

Hence make sure before mounting that all parts of the instrument exposed to the process are suitable for the existing process conditions.

These are mainly:

- Active measuring component
- Process fitting
- Process seal

Process conditions in particular are:

- Process pressure
- Process temperature
- Chemical properties of the medium
- Abrasion and mechanical influences

Permissible process pressure (MWP) - Device

The permissible process pressure range is specified by "MWP" (Maximum Working Pressure) on the type label, see chapter " *Structure*". The MWP takes the element of the measuring cell and processing fitting combination with the weakest pressure into consideration and may applied permanently. The specification refers to a reference temperature of +20 °C (+68 °F). It also applies when a measuring cell with a higher measuring range than the permissible pressure range of the process fitting is installed order-related.

In addition, a temperature derating of the process fitting, e. g. with flanges, can limit the permissible process pressure range according to the respective standard.



Note:

In order to prevent damage to the device, a test pressure may only exceed the specified MWP briefly by 1.5 times at reference temperature. The pressure stage of the process fitting as well as the overload resistance of the measuring cell are taken into consideration here (see chapter " *Technical Data*").

Protection against moisture

Protect your instrument against moisture ingress through the following measures:

- Use a suitable connection cable (see chapter " *Connecting to power supply*")
- Tighten the cable gland or plug connector

- Lead the connection cable downward in front of the cable entry or plug connector

This applies mainly to outdoor installations, in areas where high humidity is expected (e.g. through cleaning processes) and on cooled or heated vessels.

Ventilation and pressure compensation

Ventilation and pressure compensation for VEGABAR 28 are provided by an air-permeable, moisture-blocking filter element.

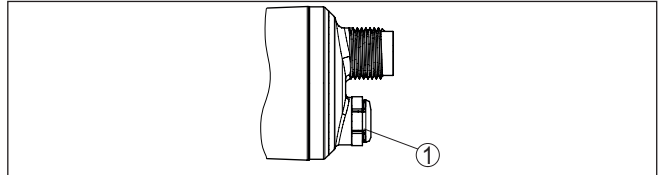


Fig. 9: Position of the filter element

1 Filter element

For effective ventilation, the filter element must always be free of buildup.

Screwing in

Devices with threaded fitting are screwed into the process fitting with a suitable wrench via the hexagon.

See chapter "Dimensions" for wrench size.



Warning:

The housing or the electrical connection may not be used for screwing in! Depending on the device version, tightening can cause damage, e.g. to the rotation mechanism of the housing.

Permissible process pressure (MWP) - Mounting accessory

The permissible process pressure range is stated on the type label. The instrument should only be operated with these pressures if the mounting accessory used also fulfils these values. This should be ensured by suitable flanges, welded sockets, tension rings with Clamp connections, sealings, etc.

Temperature limits

Higher process temperatures often mean also higher ambient temperatures. Make sure that the upper temperature limits stated in chapter "Technical data" for the environment of the electronics housing and connection cable are not exceeded.

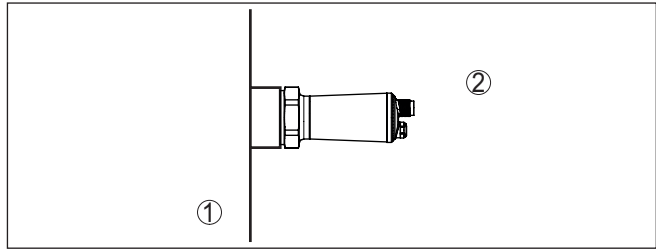


Fig. 10: Temperature ranges

- 1 Process temperature
- 2 Ambient temperature

4.2 Process pressure measurement

In gases

Keep the following in mind when setting up the measuring system:

- Mount the instrument above the measuring point

Possible condensation can then drain off into the process line.

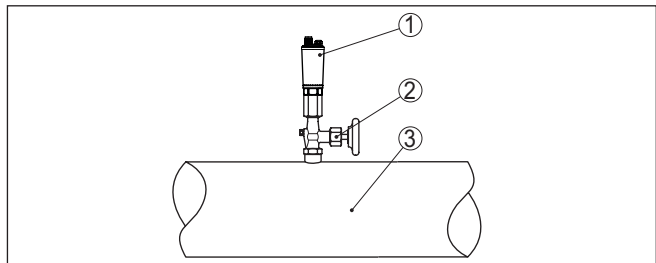


Fig. 11: Measurement setup for process pressure measurement of gases in pipelines

- 1 VEGABAR 28
- 2 Blocking valve
- 3 Pipeline

In vapours

Keep the following in mind when setting up the measuring system:

- Connect via a siphon

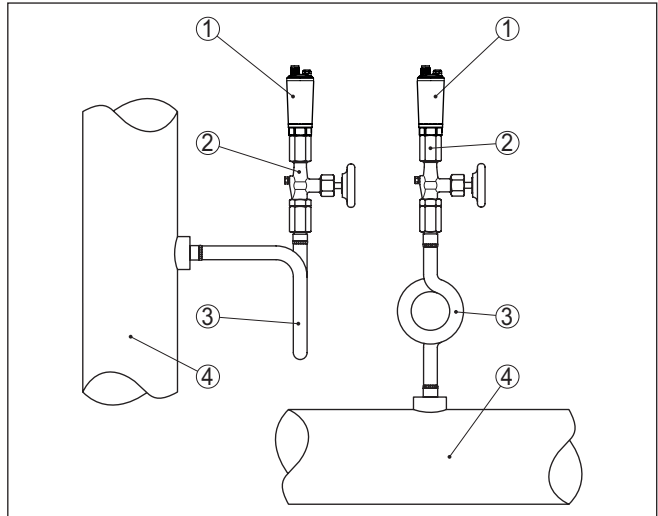


Fig. 12: Measurement setup for process pressure measurement of gases in pipelines

- 1 VEGABAR 28
- 2 Blocking valve
- 3 Siphon in U or circular form
- 4 Pipeline

A protective accumulation of water is formed through condensation in the pipe bends. Even in applications with hot steam, a medium temperature < 100 °C on the transmitter is ensured.

In liquids

Keep the following in mind when setting up the measuring system:

- Mount the instrument below the measuring point

The effective pressure line is always filled with liquid and gas bubbles can bubble up to the process line.

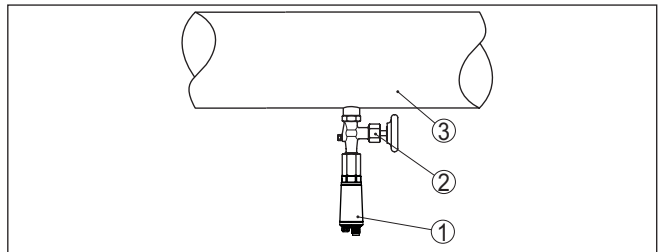


Fig. 13: Measurement setup for process pressure measurement of liquids in pipelines

- 1 VEGABAR 28
- 2 Blocking valve
- 3 Pipeline

4.3 Level measurement

Measurement setup

Keep the following in mind when setting up the measuring system:

- Mount the instrument below the min. level
- Do not mount the instrument close to the filling stream or emptying area
- Mount the instrument so that it is protected against pressure shocks from the stirrer

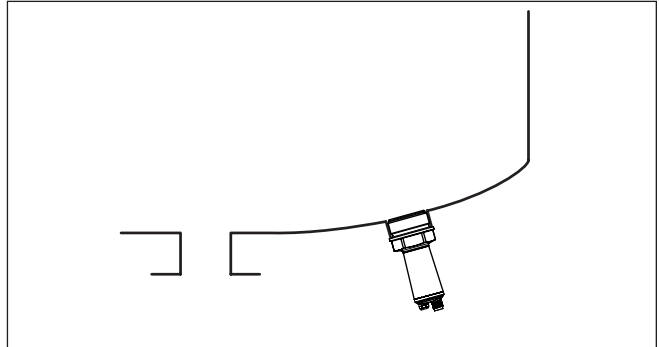


Fig. 14: Measurement setup for level measurement

5 Connecting to power supply

5.1 Preparing the connection

Safety instructions

Always keep in mind the following safety instructions:

- Carry out electrical connection by trained, qualified personnel authorised by the plant operator
- If overvoltage surges are expected, overvoltage arresters should be installed



Warning:

Only connect or disconnect in de-energized state.

Voltage supply

The data for power supply are specified in chapter " *Technical data*".



Note:

Power the instrument via an energy-limited circuit (power max. 100 W) acc. to IEC 61010-1, e.g.

- Class 2 power supply unit (acc. to UL1310)
- SELV power supply unit (safety extra-low voltage) with suitable internal or external limitation of the output current

Keep in mind the following additional factors that influence the operating voltage:

- Lower output voltage of the power supply unit under nominal load (e.g. with a sensor current of 20.5 mA or 22 mA in case of fault signal)
- Influence of additional instruments in the circuit (see load values in chapter " *Technical data*")

Connection cable

Use cable with round cross section. Depending on the plug connection, you have to select the outer diameter of the cable respectively so that the seal effect of the cable gland is ensured.

Depending on the connection method or signal output, the device is connected with standard two, three or four-wire cable without shielding.

5.2 Connection procedure

M12 x 1 plug

This plug connection requires a complete confectioned cable with counter plug.

M12 x 1 plug

5.3 Wiring plan

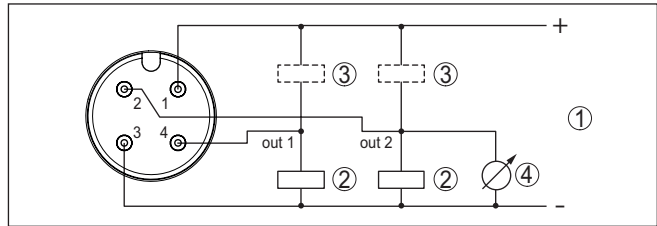


Fig. 15: Wiring plan - Three-wire with IO-Link (2 x transistor or 4 ... 20 mA plus 1 x transistor)

- 1 Voltage supply
- 2 PNP switching
- 3 NPN switching
- 4 Current output

| Contact, plug connector | Function/Polarity |
|-------------------------|---------------------------------------|
| 1 | Voltage supply/Plus |
| 2 | Transistor output 2 or current output |
| 3 | Voltage supply/Minus |
| 4 | Transistor output 1 or IO-Link port |

Direct cable outlet

 


Fig. 16: Wiring plan - Three-wire with IO-Link (2 x transistor or 4 ... 20 mA plus 1 x transistor)

- 1 Cores
- 2 Capillary line with filter attachment

| Wire colour | Function/Polarity |
|-------------|---------------------------------------|
| Brown | Voltage supply/Plus |
| White | Transistor output 2 or current output |
| Blue | Voltage supply/Minus |
| Black | Transistor output 1 or IO-Link port |

5.4 Switch-on phase

After switching on, the device first carries out a self-check:

- Internal check of the electronics
- The output signal jumps to the set fault current ²⁾
- Switching outputs are controlled

The current measured value is then output on the signal cable.

2) With current output activated

6 Access protection

6.1 Bluetooth radio interface

Devices with a Bluetooth radio interface are protected against unwanted access from outside. This means that only authorized persons can receive measured and status values and change device settings via this interface.

Bluetooth access code

A Bluetooth access code is required to establish Bluetooth communication via the adjustment tool (smartphone/tablet/notebook). This code must be entered once when Bluetooth communication is established for the first time in the adjustment tool. It is then stored in the adjustment tool and does not have to be entered again.

The Bluetooth access code is individual for each device. It is printed on the device housing with Bluetooth. In addition, it is supplied with the device in the information sheet "*PINs and Codes*". In addition, the Bluetooth access code can be read out via the display and adjustment unit, depending on the device version.

The Bluetooth access code can be changed by the user after the first connection is established. If the Bluetooth access code is entered incorrectly, the new entry is only possible after a waiting period has elapsed. The waiting time increases with each further incorrect entry.

Emergency Bluetooth unlock code

The emergency Bluetooth access code enables Bluetooth communication to be established in the event that the Bluetooth access code is no longer known. It can't be changed. The emergency Bluetooth access code can be found in information sheet "*Access protection*". If this document is lost, the emergency Bluetooth access code can be retrieved from your personal contact person after legitimation. The storage and transmission of Bluetooth access codes is always encrypted (SHA 256 algorithm).

6.2 Protection of the parameterization

The settings (parameters) of the device can be protected against unwanted changes. The parameter protection is deactivated on delivery, all settings can be made.

Device code

To protect the parameterization, the device can be locked by the user with the aid of a freely selectable device code. The settings (parameters) can then only be read out, but not changed. The device code is also stored in the adjustment tool. However, unlike the Bluetooth access code, it must be re-entered for each unlock. When using the adjustment app or DTM, the stored device code is then suggested to the user for unlocking.

Emergency device code

The emergency device code allows unlocking the device in case the device code is no longer known. It can't be changed. The emergency device code can also be found on the supplied information sheet "*Access protection*". If this document is lost, the emergency device code can be retrieved from your personal contact person after legitimation.

The storage and transmission of the device codes is always encrypted (SHA 256 algorithm).

6.3 Storing the codes in myVEGA

If the user has a "myVEGA" account, then the Bluetooth access code as well as the device code are additionally stored in his account under "*PINs and Codes*". This greatly simplifies the use of additional adjustment tools, as all Bluetooth access and device codes are automatically synchronized when connected to the "myVEGA" account

7 Setup with smartphone/tablet (Bluetooth)

7.1 Preparations

System requirements

Make sure that your smartphone/tablet meets the following system requirements:

- Operating system: iOS 8 or newer
- Operating system: Android 5.1 or newer
- Bluetooth 4.0 LE or newer

Download the VEGA Tools app from the "Apple App Store", "Google Play Store" or "Baidu Store" to your smartphone or tablet.

7.2 Connecting

Connecting

Start the adjustment app and select the function "Setup". The smartphone/tablet searches automatically for Bluetooth-capable instruments in the area.

The message "Connecting ..." is displayed.

The devices found are listed and the search is automatically continued.

Select the requested instrument in the device list.

As soon as the Bluetooth connection to a device is established, the LED display of the device in question flashes blue 4 times.

Authenticate

When establishing the connection for the first time, the operating tool and the sensor must authenticate each other. After the first correct authentication, each subsequent connection is made without a new authentication query.

Enter Bluetooth access code

For authentication, enter the 6-digit Bluetooth access code in the next menu window. You can find the code on the outside of the device housing and on the information sheet "Pins and Codes" in the device packaging.

For the very first connection, the adjustment unit and the sensor must authenticate each other.

 


Fig. 17: Enter Bluetooth access code



Note:

If an incorrect code is entered, the code can only be entered again after a delay time. This time gets longer after each incorrect entry.

The message "Waiting for authentication" is displayed on the smartphone/tablet.

Connected

After connection, the sensor adjustment menu is displayed on the respective adjustment tool.

If the Bluetooth connection is interrupted, e.g. due to a too large distance between the two devices, this is displayed on the adjustment tool. The message disappears when the connection is restored.

Change device code

Parameter adjustment of the device is only possible if the parameter protection is deactivated. When delivered, parameter protection is deactivated by default and can be activated at any time.

It is recommended to enter a personal 6-digit device code. To do this, go to menu " *Extended functions*", " *Access protection*", menu item " *Protection of the parameter adjustment*".

7.3 Sensor parameter adjustment

Enter parameters

The sensor adjustment menu is divided into two halves:

On the left you'll find the navigation section with the menus " *Setup*", " *Display*", " *Diagnosis*" and others.

The selected menu item, recognisable by the colour change, is displayed in the right half.

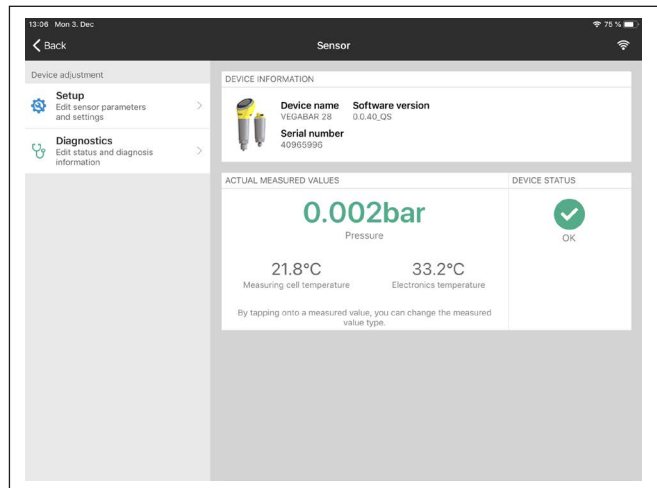


Fig. 18: Example of an app view - Setup measured values

8 Setup with PC/notebook (Bluetooth)

8.1 Preparations

System requirements

Make sure that your PC/notebook meets the following system requirements:

- Operating system Windows 10
- DTM Collection 10/2020 or newer
- Bluetooth 4.0 LE or newer

Activate Bluetooth connection

Activate the Bluetooth connection via the project assistant.



Note:

Older systems do not always have an integrated Bluetooth LE. In these cases, a Bluetooth USB adapter is required. Activate the Bluetooth USB adapter using the Project Wizard.

After activating the integrated Bluetooth or the Bluetooth USB adapter, devices with Bluetooth are found and created in the project tree.

8.2 Connecting

Connecting

Select the requested device for the online parameter adjustment in the project tree.

As soon as the Bluetooth connection to a device is established, the LED display of the device in question flashes blue 4 times.

Authenticate

When establishing the connection for the first time, the operating tool and the device must authenticate each other. After the first correct authentication, each subsequent connection is made without a new authentication query.

Enter Bluetooth access code

For authentication, enter in the next menu window the 6-digit Bluetooth access code:

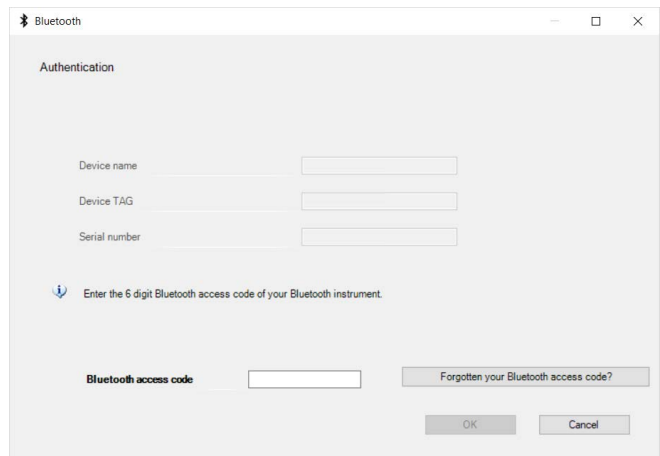


Fig. 19: Enter Bluetooth access code

You can find the code on the outside of the device housing and on the information sheet "PINs and Codes" in the device packaging.



Note:

If an incorrect code is entered, the code can only be entered again after a delay time. This time gets longer after each incorrect entry.

The message "Waiting for authentication" is displayed on the PC/notebook.

Connected

After connection, the device DTM appears.

If the connection is interrupted, e.g. due to a too large distance between device and adjustment tool, this is displayed on the adjustment tool. The message disappears when the connection is restored.

Change device code

Parameter adjustment of the device is only possible if the parameter protection is deactivated. When delivered, parameter protection is deactivated by default and can be activated at any time.

It is recommended to enter a personal 6-digit device code. To do this, go to menu "Extended functions", "Access protection", menu item "Protection of the parameter adjustment".

Prerequisites

8.3 Parameter adjustment

For parameter adjustment of the instrument via a Windows PC, the configuration software PACTware and a suitable instrument driver (DTM) according to FDT standard are required. The latest PACTware version as well as all available DTMs are compiled in a DTM Collection. The DTMs can also be integrated into other frame applications according to FDT standard.

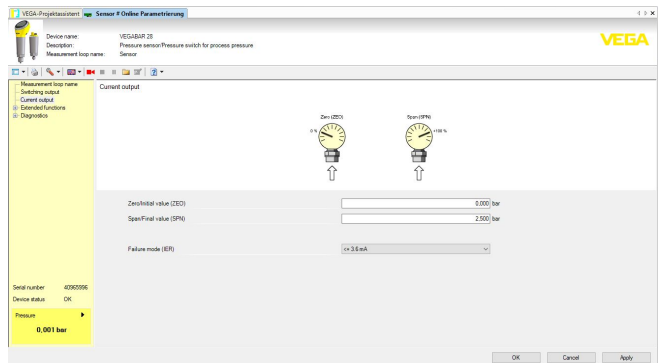


Fig. 20: Example of a DTM view - Adjustment current output

9 Menu overview

9.1 VEGA Tools app and DTM (Bluetooth)

Start image (app)

| Menu item | Device information | Actual measured values | Device status |
|-------------|--|---|----------------------|
| Start image | Device name, software version, serial number | Pressure, output current, switching status, measuring cell temperature, electronics temperature, sensor TAG | OK, error indication |

Basic functions

| Menu item | Parameter (code acc. to VDMA 24574-1) | Editing section | Basic setting |
|---|---------------------------------------|--|-----------------------|
| Measurement loop name | Measurement loop name | 19 alphanumeric characters/ special characters | Sensor |
| Switching output | Switching point (SP1) | Measuring range begin ... measuring range end | 25.00 % ³⁾ |
| | Reset point (RP1) | | 23.00 % |
| | Window upper value (FH1) | | 25.00 % |
| | Window lower value (FL1) | | 23.00 % |
| | Switching delay (DS1) | 0 ... 60 s | 0 s |
| | Reset delay (DR1) | | |
| Switching output 2 | According to switching output before | | |
| Current output | Zero 4 mA (ZEO) | Measuring range begin ... measuring range end | Measuring range begin |
| | Span 20 mA (SPN) | | Measuring range end |
| | Reaction in case of fault (FER) | ≤ 3.6 mA, ≥ 21 mA | ≤ 3.6 mA |
| 360° status indication (acc. to NAMUR NE 107) | Brightness (LED) | 0 %, 10 %, 20 % ... 100 % | 100 % |
| | Signalling | Acc. to NAMUR NE 107 | Acc. to NAMUR NE 107 |
| 360° status display (switching output) | Brightness (LED) | 0 %, 10 %, 20 ... 100 % | 100 % |
| | Signalling | Switching output | Acc. to NAMUR NE 107 |
| | Switching output | Red, yellow, green ..., individual colour selection, no signalling | Yellow |
| | Flashing | Yes, no | No |
| | Operating status | Red, yellow, green ..., individual colour selection, no signalling | Green |
| | Flashing | Yes, no | No |
| | Fault | Red, yellow, green ..., individual colour selection, no signalling | Red |
| | Flashing | Yes, no | No |

3) % values of the outputs referred to the respective nominal measuring range, setting in bar

| Menu item | Parameter (code acc. to VD-MA 24574-1) | Editing section | Basic setting |
|---------------------------------------|--|--|----------------------|
| 360° status display (free signalling) | Brightness (LED) | 0 %, 10 %, 20 % ... 100 % | 100 % |
| | Signalling | Acc. to NAMUR NE 107, switching output, free signalling | Acc. to NAMUR NE 107 |
| | Fault | Red, yellow, green ..., individual colour selection, no signalling | Red |
| | Flashing | Yes, no | No |
| | Operating status ⁴⁾ | Operating states 1, 2, 3, 4, 5 | 1 |
| | Upper limit | Measuring range begin minus 20 % ... measuring range end plus 20 % | 0.000 bar |
| | Colour selection | Red, yellow, green ..., individual colour selection, no signalling | Green |
| | Flashing | Yes, no | No |

Extended functions

| Menu item | Parameter (code acc. to VD-MA 24574-1) | Editing section | Basic setting |
|-------------------------|--|---|---|
| Damping | Integration time (DAM) | 0 ... 9.999 s | 0 s |
| | Activate thermo-shock suppression | Yes, no | No |
| Offset correction (OFS) | - | - | 0.000 bar |
| Output | Transistor function (P-N) | pnp, npn | pnp, npn |
| | Function output (OU1) | Hysteresis function closing contact (HNO), hysteresis function opening contact (HNC), window function closing contact (FNO), window function opening contact (FNC) | Hysteresis function closing contact (HNO) |
| | Function output 2 (OU2) | Hysteresis function closing contact (HNO), hysteresis function opening contact (HNC), window function closing contact (FNO), window function opening contact (FNC), 4 ... 20 mA | 4 ... 20 mA |
| Adjustment with medium | Apply min. pressure on the sensor | Accept 4 mA (LRV) | - |
| | Apply max. pressure on the sensor | Accept 20 mA (URV) | |
| Units | Pressure unit (UNI) | mbar, bar, Pa, kPa, MPa, psi, mmH ₂ O, mmHg, inH ₂ O, inHg | bar |
| | Temperature (TMP) | °C, °F | °C |

4) Signalling of process pressure ranges by colour and flashing

| Menu item | Parameter (code acc. to VD-MA 24574-1) | Editing section | Basic setting |
|-------------------|--|-----------------|-----------------------------|
| Access protection | Bluetooth access code | | Device-specific access code |
| | Protection of the parameterization | | Deactivated |
| Reset | Reset | | - |

Diagnostics

| Menu item | Parameter | Indication |
|-----------------------------|---|---|
| Status | Device status, parameter change counter | Actual values |
| Peak indicator | Process pressure, measuring cell temperature, electronics temperature | Actual values, min. values, max. values |
| Measured values | Measured values, output, additional measured values | Actual values pressure, current output, switching output, electronics temperature, measuring cell temperature |
| Measured value memory (DTM) | - | Last values |
| Simulation | Pressure, current output, switching output | Simulated values |
| Sensor information | | Device name, serial number, hardware version, software version, factory calibration date, Device Revision, measuring range begin, measuring range end |
| Sensor features (DTM) | Sensor characteristics | Features of the instrument version |

10 Diagnostics and servicing

10.1 Maintenance

Maintenance

If the device is used properly, no special maintenance is required in normal operation.

Precaution measures against buildup

In some applications, product buildup on the diaphragm can influence the measuring result. Depending on the sensor and application, take precautions to ensure that heavy buildup, and especially a hardening thereof, is avoided.

Cleaning

The cleaning helps that the type label and markings on the instrument are visible.

Take note of the following:

- Use only cleaning agents which do not corrode the housings, type label and seals
- Use only cleaning methods corresponding to the housing protection rating

10.2 Rectify faults

Reaction when malfunction occurs

The operator of the system is responsible for taking suitable measures to rectify faults.

Causes of malfunction

The device offers maximum reliability. Nevertheless, faults can occur during operation. These may be caused by the following, e.g.:

- Sensor
- Process
- Voltage supply
- Signal processing

Fault rectification

The first measures are:

- Evaluation of fault messages
- Checking the output signal
- Treatment of measurement errors

A smartphone/tablet with the adjustment app or a PC/notebook with the software PACTware and the suitable DTM offer you further comprehensive diagnostic possibilities. In many cases, the causes can be determined in this way and the faults eliminated.

Reaction after fault rectification

Depending on the reason for the fault and the measures taken, the steps described in chapter "Setup" must be carried out again or must be checked for plausibility and completeness.

24 hour service hotline

Should these measures not be successful, please call in urgent cases the VEGA service hotline under the phone no. **+49 1805 858550**.

The hotline is also available outside normal working hours, seven days a week around the clock.

Since we offer this service worldwide, the support is provided in English. The service itself is free of charge, the only costs involved are the normal call charges.

10.3 Diagnosis, fault messages

4 ... 20 mA signal

Connect a multimeter in the suitable measuring range according to the wiring plan. The following table describes possible errors in the current signal and helps to eliminate them:

| Error | Cause | Rectification |
|---|---|--|
| 4 ... 20 mA signal not stable | Fluctuating measured value | Set damping |
| 4 ... 20 mA signal missing | Electrical connection faulty | Check connection, correct, if necessary |
| | Voltage supply missing | Check cables for breaks; repair if necessary |
| | Operating voltage too low, load resistance too high | Check, adapt if necessary |
| | Short-circuit | Check, repair if necessary |
| Current signal greater than 22 mA, less than 3.6 mA | Sensor electronics defective | Replace device or send in for repair depending on device version |

LED illuminated ring

The 360° status indication on the device (see chapter "Configuration") shows the following:

- Device status
- Switching status of the transistor output
- Operating status ⁵⁾

This enables simple on-site diagnosis without tools, see the following table:

| LED illuminated ring | | | Transistor output |
|----------------------|--|--|-------------------------|
| Colour ⁶⁾ | Permanent light | Flashing | |
| Green | voltage supply on, operation without failure | Message acc. to NE 107" <i>Maintenance required</i> " available | open (high-resistance) |
| Yellow | | - | closed (low-resistance) |
| Red | voltage supply on, operation with failure | Message acc. to to NE 107 " <i>Function check</i> ", " <i>Out of specification</i> " or " <i>Simulation state</i> " is displayed | open (high-resistance) |



Note:

For devices with M12 x 1 stainless steel plug, the 360° status indication is not available.

5) Signalling of process pressure ranges by colour and flashing, adjustable via VEGA Tools app or PACTware/DTM.

6) Delivery status; adjustable via VEGA Tools app or PACTware/DTM

10.4 Status messages according to NE 107

The instrument features self-monitoring and diagnostics according to NE 107 and VDI/VDE 2650. In addition to the status messages in the following tables there are more detailed error messages available under the menu item "Diagnostics" via the respective adjustment module.

Status messages

The status messages are divided into the following categories:

- Failure
- Function check
- Out of specification
- Maintenance required

and explained by pictographs:

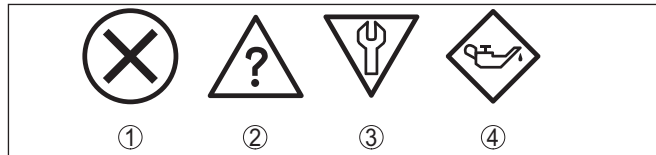


Fig. 21: Pictographs of the status messages

- 1 Failure - red
- 2 Out of specification - yellow
- 3 Function check - orange
- 4 Maintenance required - blue

Malfunction (Failure):

Due to a malfunction in the instrument, a fault signal is output.

This status message is always active. It cannot be deactivated by the user.

Function check:

The instrument is being worked on, the measured value is temporarily invalid (for example during simulation).

This status message is inactive by default.

Out of specification:

The measured value is unreliable because an instrument specification was exceeded (e.g. electronics temperature).

This status message is inactive by default.

Maintenance required:

Due to external influences, the instrument function is limited. The measurement is affected, but the measured value is still valid. Plan in maintenance for the instrument because a failure is expected in the near future (e.g. due to buildup).

This status message is inactive by default.

Failure

| Code Text message | Cause | Rectification |
|---|---|--|
| F013 no measured value available | Hardware error in the area of the measuring cell | Send instrument for repair |
| F017 Adjustment span too small | Adjustment not within specification | Change adjustment |
| F036 no operable sensor software | Failed or interrupted software update | Repeat software update |
| F080 General software error | General software error | Restart |
| F110 Switching points too close together | Selected switching points too close together | Increase the distance between the switching points |
| F111 Switching points interchanged | Switching point 1 is smaller than switching point 2 | Select switching point 1 to greater than switching point 2 |
| F260 Error in the calibration | Checksum error in the calibration values | Send instrument for repair |
| F261 Error in the instrument settings | Checksum error in the configuration values | Carry out a reset |

Function check

| Code Text message | Cause | Rectification |
|---------------------------|------------------------|--|
| C700 Simulation active | A simulation is active | Finish simulation Wait for the automatic end after 60 mins. |

Out of specification

| Code Text message | Cause | Rectification |
|---|---|---|
| S600 Impermissible electronics temperature | Temperature of the electronics in the non-specified range | Check ambient temperature Insulate electronics |
| S604 Switching output overloaded | Overload or short circuit at output 1 or 2 | Electrical connection, check load resistance |

Maintenance

| Code Text message | Cause | Rectification |
|-------------------------------------|---|---------------------------------------|
| M504 Error at a device interface | Interference of the internal communication to Bluetooth | Restart Send instrument for repair |

| Code Text message | Cause | Rectification |
|---|--|---------------------------------------|
| M510 No communication with the main controller | Fault in internal communication with the display | Restart Send instrument for repair |

10.5 Software update

The device software is updated via Bluetooth.

The following components are required:

- Instrument
- Voltage supply
- PC/notebook with PACTware/DTM and Bluetooth USB adapter
- Current instrument software as file

You can find the current instrument software as well as detailed information on the procedure in the download area of our homepage.



Caution:

Instruments with approvals can be bound to certain software versions. Therefore make sure that the approval is still effective after a software update is carried out.

You can find detailed information in the download area on our homepage.

10.6 How to proceed if a repair is necessary

You can find an instrument return form as well as detailed information about the procedure in the download area of our homepage. By doing this you help us carry out the repair quickly and without having to call back for needed information.

Proceed as follows in case of repair:

- Print and fill out one form per instrument
- Clean the instrument and pack it damage-proof
- Attach the completed form and, if need be, also a safety data sheet outside on the packaging
- Ask the agency serving you to get the address for the return shipment. You can find the agency on our homepage.

11 Dismount

11.1 Dismounting steps

To remove the device, carry out the steps in chapters " *Mounting*" and " *Connecting to power supply*" in reverse.



Warning:

When dismantling, pay attention to the process conditions in vessels or pipelines. There is a risk of injury, e.g. due to high pressures or temperatures as well as aggressive or toxic media. Avoid this by taking appropriate protective measures.

11.2 Disposal



Pass the instrument on to a specialised recycling company and do not use the municipal collecting points.

Remove any batteries in advance, if they can be removed from the device, and dispose of them separately.

If personal data is stored on the old device to be disposed of, delete it before disposal.

If you have no way to dispose of the old instrument properly, please contact us concerning return and disposal.

12 Certificates and approvals

12.1 Radio licenses

Bluetooth

The Bluetooth radio module in the device has been tested and approved according to the current edition of the applicable country-specific norms or standards.

The confirmations as well as regulations for use can be found in the document "*Radio licenses*" supplied or on our homepage.

12.2 Approvals for Ex areas

Approved versions for use in hazardous areas are available or in preparation for the device or the device series.

You can find the relevant documents on our homepage.

12.3 Ship approvals

Approved versions for use on the ship sector are available or in preparation for the device series.

You can find the relevant documents on our homepage.

12.4 Food and pharmaceutical certificates

Versions for use in the food and pharmaceutical industries are available or in preparation for the device or the device series.

The corresponding certificates can be found on our homepage.

12.5 Conformity

The device complies with the legal requirements of the applicable country-specific directives or technical regulations. We confirm conformity with the corresponding labelling.

The corresponding conformity declarations can be found on our homepage.

Due to the design of its process fittings, the device does not subject of EU pressure device directive if it is operated at process pressures ≤ 200 bar.

Electromagnetic compatibility

When using communication via IO-Link, the requirements of IEC/EN 61131-9 are fulfilled.

12.6 NAMUR recommendations

NAMUR is the automation technology user association in the process industry in Germany. The published NAMUR recommendations are accepted as the standard in field instrumentation.

The device fulfils the requirements of the following NAMUR recommendations:

- NE 21 – Electromagnetic compatibility of equipment

- NE 43 – Signal level for fault information from measuring transducers
- NE 53 – Compatibility of field devices and display/adjustment components
- NE 107 – Self-monitoring and diagnosis of field devices

For further information see www.namur.de.

12.7 Environment management system

Protection of the environment is one of our most important duties. That is why we have introduced an environment management system with the goal of continuously improving company environmental protection. The environment management system is certified according to DIN EN ISO 14001.

Help us to meet these requirements and observe the environmental instructions in the chapters "*Packaging, transport and storage*", "*Disposal*" of this operating instructions.

13 Supplement

13.1 Technical data

Note for approved instruments

The technical data in the respective safety instructions which are included in delivery are valid for approved instruments (e.g. with Ex approval). These data can differ from the data listed herein, for example regarding the process conditions or the voltage supply.

All approval documents can be downloaded from our homepage.

Materials and weights

Materials, wetted parts

| | |
|---------------------|---|
| Process fitting | 316L, PVDF, Duplex steel (1.4462), PEEK ⁷⁾ |
| Diaphragm | Sapphire-ceramic® (> 99.9 % Al ₂ O ₃ ceramic) |
| Measuring cell seal | FKM (VP2/A), EPDM (A+P 70.10-02), FFKM (Perlast G74S) |

Seal for process fitting (in the scope of delivery)

| | |
|---|--------------------------------|
| – Thread G $\frac{1}{2}$ (EN 837), thread G $\frac{1}{2}$ inside G $\frac{1}{4}$ (ISO 228-1), thread G $\frac{1}{2}$ inside 11.4 mm (ISO 228-1), thread M20 x 1.5 (EN 837), thread G $\frac{1}{2}$ (DIN 3852-A) | Klingensil C-4400 |
| – Further thread versions | Depending on the configuration |

Materials for applications in foodstuffs

Surface quality, hygienic fittings, typ.

| | |
|---------------------|-------------------------|
| – Process fitting | R _a < 0.8 µm |
| – Ceramic diaphragm | R _a < 0.5 µm |

Materials, non-wetted parts

| | |
|-------------------------------|---|
| Electronics housing | 316L |
| M12 x 1 plug connector | |
| – Contact support/Housing cap | PBT/PC, 1.4404 |
| – Contacts | CuZn, nickel layer and 0.8 µm gold-plated |
| Direct cable outlet | |
| – Cable enclosure | PBT/PC |
| – Cable | PUR |
| Weight | approx. 0.25 kg (0.55 lbs) |

Torques

Max. torque for process fitting (examples)

| | |
|---|------------------------------|
| – Thread G $\frac{1}{2}$, inside G $\frac{1}{4}$ (ISO 228-1), PVDF | 5 Nm (3.688 lbf ft) |
| – Clamp | 5/10 Nm (3.688/7.376 lbf ft) |

7) Applied for OL approval for PEEK

- Thread ½ NPT inside 6 mm, G1 10 Nm (7.376 lbf ft)
(DIN 3852-E) PEEK, G1½ (DIN 3852-A-B) PEEK
- Varivent 20 Nm (14.75 lbf ft)
- Thread G½ (ISO 228-1), G¾ 30 Nm (22.13 lbf ft)
(DIN 3852-E), M30 x 1.5, Ingold, NPT connections
- SMS, collar socket DIN 11851, 40 Nm (29.50 lbf ft)
DIN 11864-1, Form A
- Thread G½ (EN 837), G½ (DIN 3852-A), G1 (ISO 228-1), G1½ (DIN 3852-A) 50 Nm (36.88 lbf ft)
- Thread G1 with conus 100 Nm (73.76 lbf ft)

Input variable

The specifications are only an overview and refer to the measuring cell. Limitations due to the material and version of the process fitting as well as the selected pressure type are possible. The specifications on the nameplate apply. ⁸⁾

Nominal measuring ranges and overload capability in bar/kPa

| Nominal range | Overload capacity, max. pressure | Overload capacity, min. pressure |
|-----------------------------------|----------------------------------|----------------------------------|
| Gauge pressure | | |
| 0 ... +0.1 bar/0 ... +10 kPa | +15 bar/+1500 kPa | -0.2 bar/-20 kPa |
| 0 ... +0.4 bar/0 ... +40 kPa | +30 bar/+3000 kPa | -0.8 bar/-80 kPa |
| 0 ... +1 bar/0 ... +100 kPa | +35 bar/+3500 kPa | -1 bar/-100 kPa |
| 0 ... +2.5 bar/0 ... +250 kPa | +50 bar/+5000 kPa | -1 bar/-100 kPa |
| 0 ... +5 bar/0 ... +500 kPa | +65 bar/+6500 kPa | -1 bar/-100 kPa |
| 0 ... +10 bar/0 ... +1000 kPa | +90 bar/+9000 kPa | -1 bar/-100 kPa |
| 0 ... +25 bar/0 ... +2500 kPa | +130 bar/+13000 kPa | -1 bar/-100 kPa |
| 0 ... +60 bar/0 ... +6000 kPa | +200 bar/+20000 kPa | -1 bar/-100 kPa |
| -0.05 ... +0.05 bar/-5 ... +5 kPa | +15 bar/+1500 kPa | -0.2 bar/-20 kPa |
| -0.2 ... +0.2 bar/-20 ... +20 kPa | +20 bar/+2000 kPa | -0.4 bar/-40 kPa |
| -0.5 ... +0.5 bar/-50 ... +50 kPa | +35 bar/+3500 kPa | -1 bar/-100 kPa |
| -1 ... 0 bar/-100 ... 0 kPa | +35 bar/+3500 kPa | -1 bar/-100 kPa |
| -1 ... +1.5 bar/-100 ... +150 kPa | +40 bar/+4000 kPa | -1 bar/-100 kPa |
| Absolute pressure | | |
| 0 ... 0.1 bar/0 ... 10 kPa | 15 bar/1500 kPa | 0 bar abs. |
| 0 ... 1 bar/0 ... 100 kPa | 35 bar/3500 kPa | 0 bar abs. |
| 0 ... 2.5 bar/0 ... 250 kPa | 50 bar/5000 kPa | 0 bar abs. |
| 0 ... +5 bar/0 ... +500 kPa | 65 bar/+6500 kPa | 0 bar abs. |
| 0 ... 10 bar/0 ... 1000 kPa | 90 bar/9000 kPa | 0 bar abs. |

8) Data on overload capability apply for reference temperature.

| Nominal range | Overload capacity, max. pressure | Overload capacity, min. pressure |
|-----------------------------|----------------------------------|----------------------------------|
| 0 ... 25 bar/0 ... 2500 kPa | +130 bar/+13000 kPa | 0 bar abs. |
| 0 ... 60 bar/0 ... 6000 kPa | +200 bar/+20000 kPa | 0 bar abs. |

Nominal measuring ranges and overload capacity in psi

| Nominal range | Overload capacity, max. pressure | Overload capacity, min. pressure |
|--------------------|----------------------------------|----------------------------------|
| Gauge pressure | | |
| 0 ... +1.5 psig | +225 psig | -3 psig |
| 0 ... +5 psig | +435 psig | -12 psig |
| 0 ... +15 psig | +525 psig | -14.51 psig |
| 0 ... +30 psig | +725 psig | -14.51 psig |
| 0 ... +75 psig | +950 psig | -14.51 psig |
| 0 ... +150 psig | +1300 psig | -14.51 psig |
| 0 ... +300 psig | +1900 psig | -14.51 psig |
| 0 ... +900 psig | +2900 psig | -14.51 psig |
| -0.7 ... +0.7 psig | +225 psig | -3 psig |
| -3 ... +3 psig | +290 psi | -6 psig |
| -7 ... +7 psig | +525 psig | -14.51 psig |
| -14.5 ... 0 psig | +525 psig | -14.51 psig |
| -14.5 ... +20 psig | +580 psig | -14.51 psig |
| Absolute pressure | | |
| 0 ... 15 psi | 525 psi | 0 psi |
| 0 ... 30 psi | 600 psi | 0 psi |
| 0 ... +75 psi | 975 psi | 0 psi |
| 0 ... 150 psi | 1350 psi | 0 psi |
| 0 ... 300 psi | 1500 psi | 0 psi |
| 0 ... 900 psi | +2900 psi | 0 psi |

Adjustment ranges

Specifications refer to the nominal measuring range, pressure values lower than -1 bar cannot be set

Zero/Span adjustment:

- Zero -20 ... +95 %
- Span -120 ... +120 %

Maximum permissible Turn Down Unlimited (recommended 20 : 1)

Switch-on phase

Start-up time with operating voltage U_B ≤ 2 s

Starting current for run-up time ≤ 3.6 mA

Output variable - three-wire 4 ... 20 mA

| | |
|---|--|
| Output signal | 4 ... 20 mA (active) |
| Connection technology | Three-wire |
| Range of the output signal | 3.8 ... 20.5 mA (default setting) |
| Signal resolution | 5 μ A |
| Fault signal, current output (adjustable) | Last valid measured value, ≥ 21 mA, ≤ 3.6 mA (Default) |
| Max. output current | 21.5 mA |
| Load | See load resistance under Power supply |

Output variable - Three-wire 1 x transistor

| | |
|--------------------------|---|
| Output signal | Transistor PNP or NPN can be configured |
| Connection technology | Three-wire |
| Load current | max. 250 mA |
| Overload resistance | yes |
| Short-circuit resistance | Permanently |
| Voltage loss | < 3 V |
| Inverse current PNP | < 10 μ A |
| Inverse current NPN | < 25 μ A |

Output variable - Three-wire 2 x transistor

| | |
|--------------------------|--|
| Output signal | Transistor PNP or NPN can be configured |
| Connection technology | Three-wire |
| Load current | max. 250 mA |
| Overload resistance | yes |
| Short-circuit resistance | Permanently |
| Voltage loss | < 3 V |
| Inverse current PNP | < 10 μ A |
| Inverse current NPN | < 25 μ A |
| Function | |
| – Output 1 | Switching output or IO-Link |
| – Output 2 | Switching output or 4 ... 20 mA (active) |

Output variable - Three-wire IO-Link

| | |
|---------------|-----------------------------|
| Output signal | IO-Link acc. to IEC 61131-9 |
|---------------|-----------------------------|

Dynamic behaviour output

Dynamic characteristics - Current output

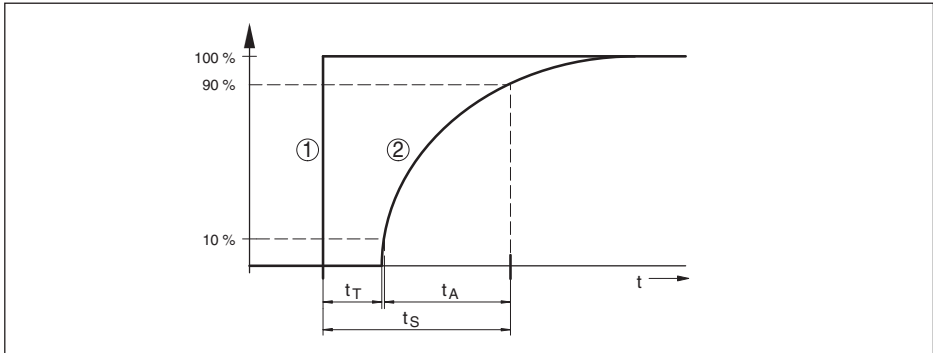


Fig. 22: Behaviour the current output in case of sudden change of the process variable. t_T : dead time; t_A : rise time; t_S : jump response time

- 1 Process variable
2 Output signal

| Size | Time |
|---|-------------|
| Dead time | ≤ 2 ms |
| Rise time (10 ... 90 %) | ≤ 4 ms |
| Step response time (ti: 0 s, 10 ... 90 %) | ≤ 6 ms |

Reaction time transistor output with ≤ 10 ms
switching relevant change of the process
variable total

Damping (63 % of the input variable) 0 ... 9 s, adjustable

Reference conditions and influencing variables (according to DIN EN 60770-1)

Reference conditions according to DIN EN 61298-1

- Temperature +15 ... +25 °C (+59 ... +77 °F)
- Relative humidity 45 ... 75 %
- Air pressure 860 ... 1060 mbar/86 ... 106 kPa (12.5 ... 15.4 psig)

Determination of characteristics Limit point adjustment according to IEC 61298-2

Characteristic curve Linear

Reference installation position upright, diaphragm points downward

Influence of the installation position < 0.2 mbar/20 Pa (0.003 psig)

Deviation (according to IEC 60770)

Applies to the 4 ... 20 mA current output and refers to the adjusted span. Turn down (TD) is the relation nominal measuring range/adjusted span.

| Accuracy class | Non-linearity, hysteresis and repeatability with TD 1 : 1 up to 5 : 1 | Non-linearity, hysteresis and repeatability with 5 : 1 |
|----------------|---|--|
| 0.3 % | < 0.3 % | < 0.06 % x TD |

Influence of the medium or ambient temperature

Average temperature coefficient of the zero signal

- In the compensated temperature range ⁹⁾ < 0.15 %/10 K
- Outside the compensated temperature range typ. 0.3 %/10 K

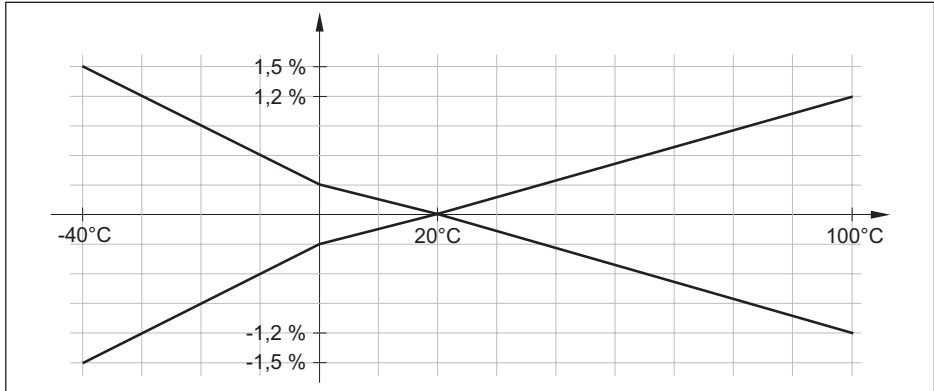


Fig. 23: Temperature error with TD 1 : 1

Long-term stability (according to DIN 16086)

Specifications refer to the set span. Turn down (TD) is the ratio: nominal measuring range/set span.

| Time period | Long-term drift zero signal and output span |
|-------------|---|
| One year | < 0.1 % x TD |
| Two years | < 0.15 % x TD |
| Five years | < 0.2 % x TD |
| Ten years | < 0.4 % x TD |

Ambient conditions

- Ambient temperature -40 ... +80 °C (-40 ... +176 °F)
- Storage and transport temperature -40 ... +80 °C (-40 ... +176 °F)

Mechanical environmental conditions

- Vibrations (oscillations) Class 4M8 acc. to IEC 60271-3-4 (5 g at 4 ... 200 Hz)
- Impacts (mechanical shock) Class 6M4 acc. to IEC 60271-3-6 (50 g, 2.3 ms)
- Impact resistance
 - Plug according to ISO 4400 IK07 acc. to IEC 62262
 - M12 x 1 plug, direct cable outlet IK05 acc. to IEC 62262

Process conditions

Process temperature

9) 0 ... +100 °C (+32 ... +212 °F)

57541-EN-220826

| Measuring cell seal | | Process temperature with process fitting | | |
|---------------------|--------------|--|--|----------------------------------|
| | | 316L, Duplex steel | PVDF | PEEK ¹⁰⁾ |
| FKM | VP2/A | -20 ... +130 °C (-4 ... +266 °F) | | |
| EPDM | A+P 70.10-02 | -40 ... +130 °C (-40 ... +266 °F) | -20 ... +80 °C (-4 ... +176 °F) ¹¹⁾ | -20 ... +100 °C (-4 ... +212 °F) |
| FFKM | Perlast G74S | -15 ... +130 °C (+5 ... +266 °F) | | |

Temperature derating

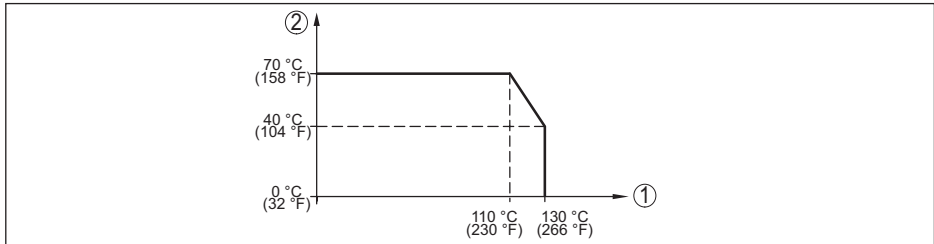


Fig. 24: Temperature derating VEGABAR 28

- 1 Process temperature
2 Ambient temperature

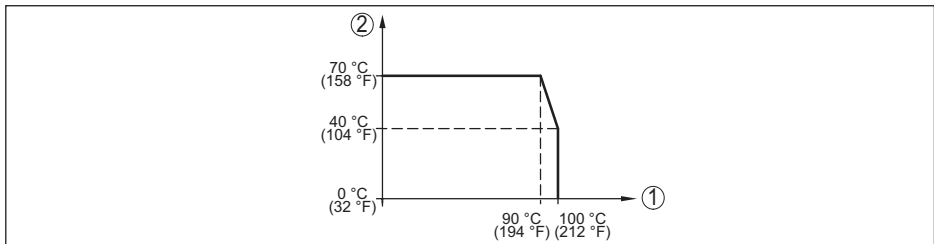


Fig. 25: Temperature derating VEGABAR 28, with activated Bluetooth communication

- 1 Process temperature
2 Ambient temperature

SIP process temperature¹²⁾

Device configuration suitable for vapour, i.e. measuring cell seal EPDM or FFKM (Perlast G74S), previous CIP cleaning up to max. +80 °C (+176 °F): ¹³⁾

SIP process temperature with vapour stratification up to

- 15 minutes +150 °C (+302 °F)
- 30 minutes +140 °C (+284 °F)
- 1 hour +135 °C (+275 °F)

18 Applied for OL approval

11) Process pressures > 5 bar: 20 ... +60 °C (-4 ... +140 °F)

12) SIP = Sterilization in place

13) CIP = Cleaning in place

Process pressure

Permissible process pressure see specification "MWP" on the type label ¹⁴⁾

Indication

Status indication LED illuminated ring (green-yellow-red)

Adjustment

| | |
|-------------------|----------------|
| PC/Notebook | PACTware/DTM |
| Smartphone/Tablet | Adjustment app |
| IO-Link master | IODD |

Bluetooth interface

| | |
|-------------------------------------|---|
| Bluetooth standard | Bluetooth 5.0 (downward compatible to Bluetooth 4.0 LE) |
| Frequency | 2.402 ... 2.480 GHz |
| Max. emitted power | +2.2 dBm |
| Max. number of participants | 1 |
| Effective range typ. ¹⁵⁾ | 25 m (82 ft) |

Measuring cell temperature

| | |
|---|---|
| Range | -40 ... +130 °C (-40 ... +266 °F) |
| Resolution | < 0.2 K |
| Deviation | ±3 K |
| Output of the temperature values via ¹⁶⁾ | Display and adjustment unit, Bluetooth, IO-Link |

Electromechanical data

| | |
|--|--|
| Round plug connector | 4-pole with M12 x 1 screw connection |
| Direct cable outlet | |
| – Standard length | 5 m (16.4 ft), 10 m (32.81 ft), 15 m (49.21 ft), 25 m (82.02 ft), 50 m (164.04 ft) |
| – Freely selectable cable length (meter steps) | 1 ... 49 m (3.280 ... 160.8 ft) |
| – Wire cross-section | 0.34 mm ² (AWG 21) |
| – Diameter | approx. 8 mm |
| – Min. bending radius (at 25 °C/77 °F) | 25 mm |

Voltage supply

| | |
|---------------------------------------|----------------|
| Operating voltage U_B | 12 ... 35 V DC |
| Max. power consumption ¹⁷⁾ | |
| – Sensor | 700 mW |

15) Depending on the local conditions; with M12 x 1 plug stainless steel (closed full metal housing) effective range up to approx. 5 m (16.40 ft)

16) Depending on the instrument version

17) $U_B = 35$ V DC, output signal = 20 mA

| | |
|---|---|
| – Load per transistor output ¹⁸⁾ | 9 W |
| Reverse voltage protection | Integrated |
| Permissible residual ripple | |
| – for U_N 12 V DC ($12\text{ V} < U_B < 18\text{ V}$) | $\leq 0.7 V_{\text{eff}}$ (16 ... 400 Hz) |
| – for U_N 24 V DC ($18\text{ V} < U_B < 35\text{ V}$) | $\leq 1 V_{\text{eff}}$ (16 ... 400 Hz) |
| Max. load resistor | |
| – Operating voltage $U_B = 12\text{ V DC}$ | 370 Ω |
| – Operating voltage $U_B = 18\text{ V DC}$ | 630 Ω |

Electrical protective measures

Potential separation Electronics potential free up to 500 V AC

Protection rating

| Connection technology | Protection according to EN 60529/IEC 529 | Protection according to NEMA/UL 50E |
|-----------------------|--|-------------------------------------|
| M12 x 1 plug | IP66/IP67/IP69 | Type 6P |
| Direct cable outlet | IP66/IP68 (0.5 bar) | |

Altitude above sea level 5000 m (16404 ft)

Protection class III

Pollution degree 4

13.2 Device communication IO-Link

In the following, the necessary device-specific details are shown. You can find further information of IO-Link on www.io-link.com.

Physical layer

IO-Link specification: Revision 1.1

SIO mode: Yes

Speed: COM2 38.4 kBaud

Min. cycle time 4.0 ms

Length process data word: 32 Bit

IO-Link Data Storage: Yes

Block parameter adjustment: Yes

Direct parameter

| Byte | Parameter | HexCode | Remark, value |
|------|----------------------|---------|----------------------------|
| 0 | - | - | - |
| 1 | MasterCycleTime | - | - |
| 2 | MinCycleTime | 0x28 | 4 ms |
| 3 | M-SequenceCapability | 0x2B | Frametypes, SIO-Mode, ISDU |

| Byte | Parameter | HexCode | Remark, value |
|-----------|----------------------------|------------------|----------------------|
| 4 | Revision ID | 0x11 | IO-Link Revision 1.1 |
| 5 | Input process data length | - | 4 Byte |
| 5 | Output process data length | - | 0 Byte |
| 7, 8 | VendorID | 0x00, 0x62 | 98 |
| 9, 10, 11 | DeviceID | 0x00, 0x01, 0x01 | 257 |

Process data word

Configuration

| Bit | 31 (MSB) | ... | 16 | 15 | ... | 2 | 1 | 0 (LSB) |
|--------|--|-----|----|-------------------------------------|-----|---|------|---------|
| Sensor | Pressure in 0.1 % of the measuring range | | | Temperature in °C, resolution 0.1 K | | | Out2 | Out1 |

Formats

| | Value | Type |
|-------------|--------|---------|
| Out1 | 1 Bit | Boolean |
| Out2 | 1 Bit | Boolean |
| Temperature | 14 Bit | Integer |
| Pressure | 16 Bit | Integer |

Events

| | HexCode | Type |
|------|---------|---------------|
| 6202 | 0x183A | FunctionCheck |
| 6203 | 0x183B | Maintenance |
| 6204 | 0x183C | OutOfSpec |
| 6205 | 0x183D | Failure |

Device data ISDU

Device data can be parameters, identification data and diagnostic information. They are exchanged acyclically and on request of the IO-Link master. Device data can be written to the sensor (write) or read from the device (read). The ISDU (Indexed Service Data Unit) determines, among other things, whether the data is read or written.

IO-Link specific device data

| Data | ISDU (dez) | ISDU (hex) | Size (Byte) | Data type | Access | Value |
|------------------------|------------|------------|-------------|---------------|--------|------------|
| DeviceAccess | 12 | 0x000C | | | RW | - |
| Profile Identification | 13 | 0x000D | 2 | Unsigned8 [2] | RO | 0x40, 0x00 |

| Data | ISDU (dez) | ISDU (hex) | Size (Byte) | Data type | Access | Value |
|-------------------------|------------|------------|-------------|----------------|--------|--|
| PD-Descriptor | 14 | 0x000E | 12 | Unsigned8 [12] | RO | 0x01, 0x01, 0x00, 0x01, 0x01, 0x01, 0x03, 0x0E, 0x02, 0x03, 0x0E, 0x10 |
| VendorName | 16 | 0x0010 | 31 | String | RO | VEGA Grieshaber KG |
| VendorText | 17 | 0x0011 | 31 | String | RO | www.vega.com |
| ProductName | 18 | 0x0012 | 31 | String | RO | VEGABAR |
| ProductID | 19 | 0x0013 | 31 | String | RO | VEGABAR 2x/3x |
| ProductText | 20 | 0x0014 | 31 | String | RO | Pressure sensor/Pressure switch |
| SerialNumber | 21 | 0x0015 | 16 | String | RO | - |
| Hardware Revision | 22 | 0x0016 | 20 | String | RO | - |
| Software Revision | 23 | 0x0017 | 20 | String | RO | - |
| Application SpecificTag | 24 | 0x0018 | Max. 31 | String | RW | Sensor |
| FunctionTag | 25 | 0x0019 | Max. 31 | String | RW | - |
| LocationTag | 26 | 0x001A | Max. 31 | String | RW | - |
| DeviceStatus | 36 | 0x0024 | 1 | Unsigned8 [2] | RO | - |
| Detailed DeviceStatus | 37 | 0x0025 | 12 | Unsigned8 [12] | RO | - |
| PDin | 40 | 0x0028 | 4 | - | RO | See process data word |

VEGA-specific device data

| Data | ISDU (dez) | ISDU (hex) | Size (Byte) | Data type | Access | Value range |
|---------------------------------|------------|------------|-------------|-----------|--------|--------------|
| Measurement loop name (TAG) | 256 | 0x0100 | 20 | String | RW | - |
| Switching point (SP1) | 257 | 0x0101 | 4 | Float | RW | - |
| - | 258 | 0x0102 | - | - | - | - |
| Reset point (RP1) | 259 | 0x0103 | 4 | Float | RW | - |
| Switching delay (DS1) | 260 | 0x0104 | 4 | Float | RW | 0.0 ... 60.0 |
| Reset delay (DR1) | 261 | 0x0105 | 4 | Float | RW | 0.0 ... 60.0 |
| Window upper value output (FH1) | 262 | 0x0106 | 4 | Float | RW | - |

| Data | ISDU (dez) | ISDU (hex) | Size (Byte) | Data type | Access | Value range |
|--|------------|------------|-------------|-----------|--------|--|
| Window lower value output (FL1) | 263 | 0x0107 | 4 | Float | RW | - |
| Switching delay (DS1) | 264 | 0x0108 | 4 | Float | RW | 0.0 ... 60.0 |
| Reset delay (DR1) | 265 | 0x0109 | 4 | Float | RW | 0.0 ... 60.0 |
| Switching point (SP2) | 266 | 0x010A | 4 | Float | RW | - |
| Reset point (RP2) | 267 | 0x010B | 4 | Float | RW | - |
| Switching delay (DS2) | 268 | 0x010C | 4 | Float | RW | - |
| Reset delay (DR2) | 269 | 0x010D | 4 | Float | RW | - |
| Window upper value output (FH2) | 270 | 0x010E | 4 | Float | RW | - |
| Window lower value output (FL2) | 271 | 0x010F | 4 | Float | RW | - |
| Switching delay (DS2) | 272 | 0x0110 | 4 | Float | RW | 0.0 ... 60.0 |
| Reset delay (DR2) | 273 | 0x0111 | 4 | Float | RW | 0.0 ... 60.0 |
| Zero/Initial value (ZEO) | 274 | 0x0112 | 4 | Float | RW | - |
| Span/Final value (SPN) | 275 | 0x0113 | 4 | Float | RW | - |
| Failure mode (IER) | 276 | 0x0114 | 1 | Unsigned8 | RW | 0=<3.6mA, 1=>=21mA |
| Integration time (DAM) | 277 | 0x0115 | 4 | Float | RW | 0.0 ... 9.000 |
| Activate thermoshock suppression (TSC) | 278 | 0x0115 | 1 | Unsigned8 | RW | 0=No, 1=Yes |
| Setpoint value | 279 | 0x0117 | 4 | Float | RW | - |
| Transistor function (P-N) | 280 | 0x0118 | 1 | Unsigned8 | RW | 0=pnp, 1=npn |
| Function output (OU1) | 281 | 0x0119 | 1 | Unsigned8 | RW | 0=HNO, 1=HNC, 2=FNO, 3=FNC |
| Function output (OU2) | 282 | 0x011A | 1 | Unsigned8 | RW | 0=HNO, 1=HNC, 2=FNO, 3=FNC, 4 = 4 ... 20 mA |
| Lighting (DIS) | 283 | 0x011B | 1 | Unsigned8 | RW | 0=Off, 1=On |
| Menu language (LG) | 284 | 0x011C | 1 | Unsigned8 | RW | 49=DE, 44=EN 33=FR, 34=ES, 35=PT, 39=IT, 31=NL, 7=RU, 81=JP, 86 = CN, 90=TR |
| Brighness illuminated ring | 285 | 0x011D | 1 | Unsigned8 | RW | 0=0%, ... 100=100% |
| Signalling | 286 | 0x011E | 1 | Unsigned8 | RW | 0=individual 1=Acc to NAMUR NE 107 |

| Data | ISDU (dez) | ISDU (hex) | Size (Byte) | Data type | Access | Value range |
|------------------------------------|------------|------------|-------------|------------|--------|--|
| Failure | 287 | 0x011F | 1 | Unsigned8 | RW | 0=Individually colour, 1=Red, 2=Orange, 3=White, 4=Green, 5=Blue, 6=Yellow, 7=No signalling |
| Switching output | 288 | 0x0120 | 1 | Unsigned8 | RW | 0=Individually colour, 1=Red, 2=Orange, 3=White, 4=Green, 5=Blue, 6=Yellow, 7=No signalling |
| Operating Status | 289 | 0x0121 | 1 | Unsigned8 | RW | 0=Individually colour, 1=Red, 2=Orange, 3=White, 4=Green, 5=Blue, 6=Yellow, 7=No signalling |
| Signalizing operating Status red | 290 | 0x0122 | 1 | Unsigned8 | RW | 0...255 |
| Signalizing operating Status green | 291 | 0x0123 | 1 | Unsigned8 | RW | 0...255 |
| Signalizing operating Status blue | 292 | 0x0124 | 1 | Unsigned8 | RW | 0...255 |
| Signalizing failure red | 293 | 0x0125 | 1 | Unsigned8 | RW | 0...255 |
| Signalizing failure green | 294 | 0x0126 | 1 | Unsigned8 | RW | 0...255 |
| Signalizing failure blue | 295 | 0x0127 | 1 | Unsigned8 | RW | 0...255 |
| Signalizing Switching output green | 296 | 0x0128 | 1 | Unsigned8 | RW | 0...255 |
| Signalizing Switching output red | 297 | 0x0129 | 1 | Unsigned8 | RW | 0...255 |
| Signalizing Switching output blue | 298 | 0x012A | 1 | Unsigned8 | RW | 0...255 |
| Pressure unit (UNI) | 299 | 0x012B | 2 | Unsigned16 | RW | 1130=Pa, 1132=MPa, 1133=kPa, 1137=bar, 1138=mbar, 1141=psi, 1146=inH2O, 1149=mmH2O, 1155=inHg, 1157=mmHg |
| Temperature unit (TMP) | 300 | 0x012C | 2 | Unsigned16 | RW | 1001=°C, 1002=°F |
| Bluetooth access code (BT) | 301 | 0x012D | 6 | String | RW | Numerical value |

| Data | ISDU (dez) | ISDU (hex) | Size (Byte) | Data type | Access | Value range |
|--|------------|------------|-------------|------------|--------|--|
| Protection of parameter adjustment | 302 | 0x012E | 1 | Unsigned8 | RO | 0=deactivated, 1=activated (with device code) |
| Device status acc. to NE 107 | 303 | 0x012F | 1 | Unsigned8 | RO | 0=Good, 1=Function check, 2=Maintenance requested, 3=Out of specification, 4=Failure |
| Device status | 304 | 0x0130 | 19 | String | RO | |
| Detailed status | 305 | 0x0131 | 4 | Unsigned32 | RO | |
| Counter for change of parameters (PCO) | 306 | 0x0132 | 4 | Unsigned32 | RO | |
| Pressure | 307 | 0x0133 | 4 | Float | RO | - |
| Pointer min. pressure | 308 | 0x0134 | 4 | Float | RO | - |
| Pointer max. pressure | 309 | 0x0135 | 4 | Float | RO | - |
| Measuring cell temperature | 310 | 0x0136 | 4 | Float | RO | - |
| - | 311 | 0x0137 | - | - | - | - |
| Min. measuring cell temperature | 312 | 0x0138 | 4 | Float | RO | - |
| Max. measuring cell temperature | 313 | 0x0139 | 4 | Float | RO | - |
| Electronics temperature | 314 | 0x013A | 4 | Float | RO | - |
| Min. electronics temperature | 315 | 0x013B | 4 | Float | RO | - |
| Max. electronics temperature | 316 | 0x013C | 4 | Float | RO | - |
| Current output | 317 | 0x013D | 4 | Float | RO | |
| Switching output | 318 | 0x013E | 1 | Float | RO | 0=Open, 1=Closed |
| Switching output 2 | 319 | 0x013F | 1 | Float | RO | 0=Open, 1=Closed |
| Simulation pressure | 320 | 0x0140 | 1 | Unsigned8 | RW | 0=Off, 1=On |
| Simulation value | 321 | 0x0141 | 4 | Float | RW | - |
| Simulation current | 322 | 0x0142 | 1 | Unsigned8 | RW | 0=Off, 1=On |
| Simulation value | 323 | 0x0143 | 4 | Float | RW | - |
| Simulation switching output | 324 | 0x0144 | 1 | Unsigned8 | RW | 0=Off, 1=On |
| Simulation value | 325 | 0x0145 | 1 | Unsigned8 | RW | - |
| Simulation switching output 2 | 326 | 0x0146 | 1 | Unsigned8 | RW | 0=Off, 1=On |
| Simulation value | 327 | 0x0147 | 1 | Unsigned8 | RW | 0=Open, 1=Close |

| Data | ISDU (dez) | ISDU (hex) | Size (Byte) | Data type | Access | Value range |
|----------------------------|------------|------------|-------------|------------|--------|-------------|
| Device name | 328 | 0x0148 | 19 | String | RO | - |
| Serial number | 329 | 0x0149 | 16 | String | RO | - |
| Hardware version | 330 | 0x014A | 19 | String | RO | - |
| Software version | 331 | 0x014B | 19 | String | RO | - |
| Device revision | 332 | 0x014C | 2 | Unsigned16 | RO | - |
| Begin of measurement range | 333 | 0x014D | 4 | Float | RO | - |
| End of measurement range | 334 | 0x014E | 4 | Float | RO | - |

System commands

| Command | ISDU (dez) | ISDU (hex) | Access |
|--------------------------------------|------------|------------|--------|
| Factory reset | 130 | 0x082 | WO |
| Reset pointer pressure | 160 | 0x0A0 | WO |
| Reset pointer temperature | 161 | 0x0A1 | WO |
| Reset pointer electronic temperature | 162 | 0x0A2 | WO |
| Adopt 4 mA (LRV) | 163 | 0x0A3 | WO |
| Adopt 20 mA (URV) | 164 | 0x0A4 | WO |
| Adopt setpoint value | 165 | 0x0A5 | WO |

13.3 Dimensions

Connection technology

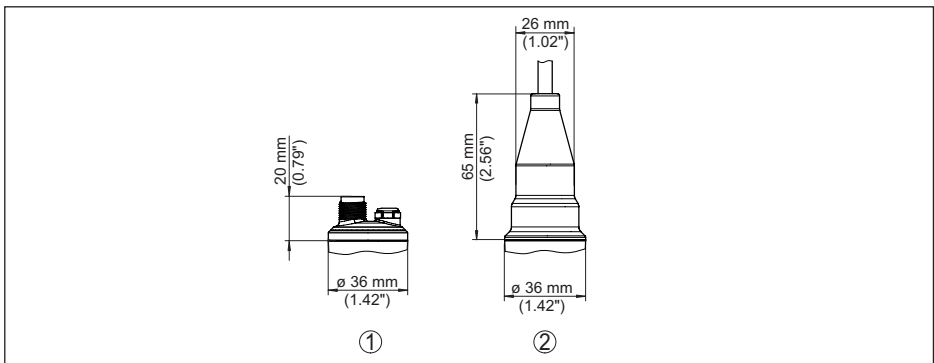


Fig. 26: Connection technology VEGABAR 28

- 1 M12 x 1 plug connector
- 2 Direct cable outlet

VEGABAR 28, threaded fitting not front-flush

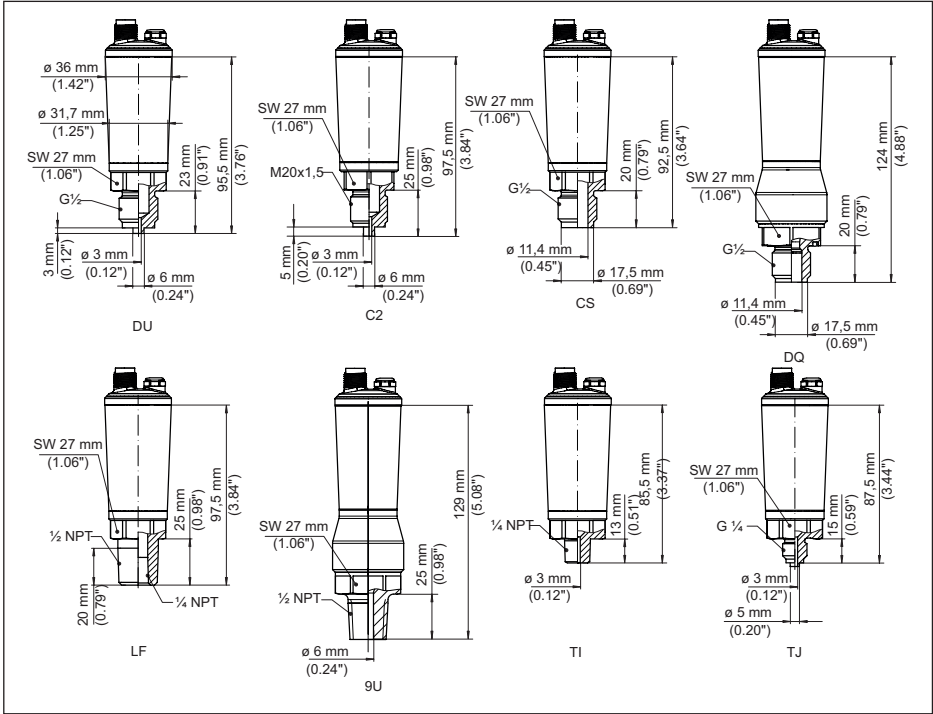


Fig. 27: VEGABAR 28, threaded fitting not front-flush

- DU Thread G $\frac{1}{2}$ (EN 837), manometer connection
- C2 Thread M20 x 1.5 (EN 837), manometer connection
- CS Thread G $\frac{1}{2}$, inside G $\frac{1}{4}$ A (ISO 228-1), Duplex steel (1.4462)
- DQ Thread G $\frac{1}{2}$, inside G $\frac{1}{4}$ A (ISO 228-1), PVDF
- LF Thread $\frac{1}{2}$ NPT, inside $\frac{1}{4}$ NPT (ASME B1.20.1)
- 9U Thread $\frac{1}{2}$ NPT, inside 6 mm PEEK
- TI Thread $\frac{1}{4}$ NPT (ASME B1.20.1)
- TJ Thread G $\frac{1}{4}$ (ISO 228-1)

VEGABAR 28, threaded fitting front-flush

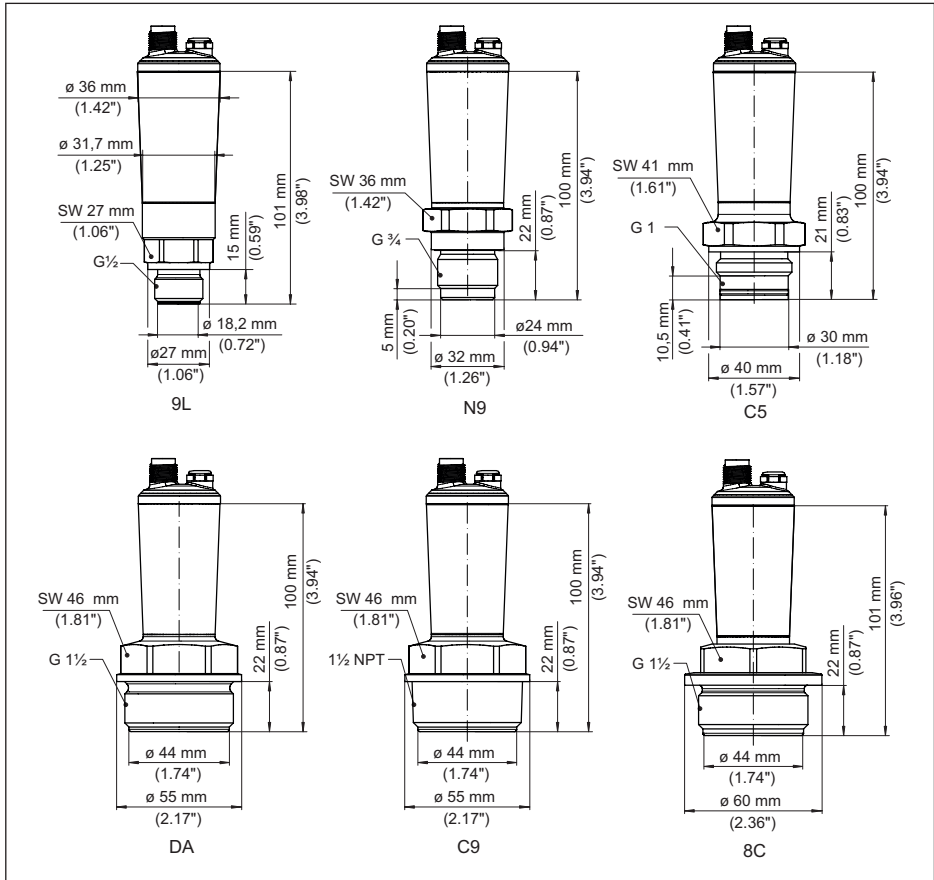


Fig. 28: VEGABAR 28, threaded fitting front-flush

9L Thread $G\frac{1}{2}$ (DIN 3852-A)N9 Thread $G\frac{3}{4}$ (DIN 3852-E)

C5 Thread G1 (ISO 228-1)

DA Thread $G1\frac{1}{2}$ (DIN 3852-A)C9 Thread $1\frac{1}{2}$ NPT (ASME B1.20.1)8C Thread $G1\frac{1}{2}$ (DIN 3852-E), PEEK

VEGABAR 28, threaded fitting front-flush with cone/extension

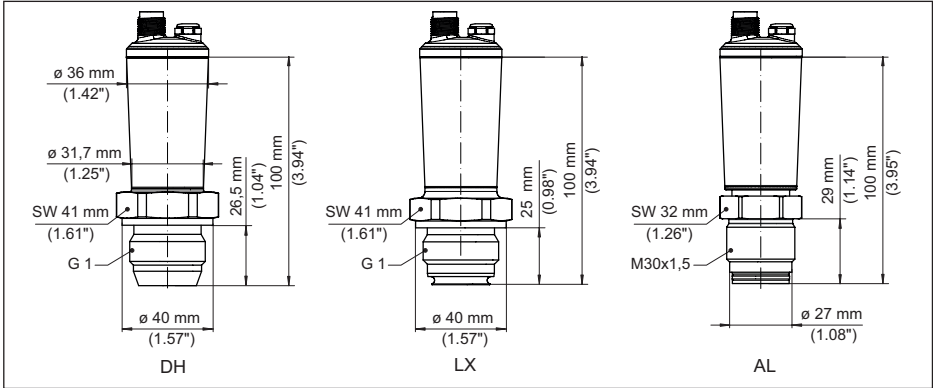


Fig. 29: VEGABAR 28, cone/extension fitting

DH Thread G1 (ISO 228-1), cone 40°

LX Thread G1 (ISO 228-1), hygienic design

AL Thread M30 x 1.5 (DIN 13)

VEGABAR 28, hygienic fitting

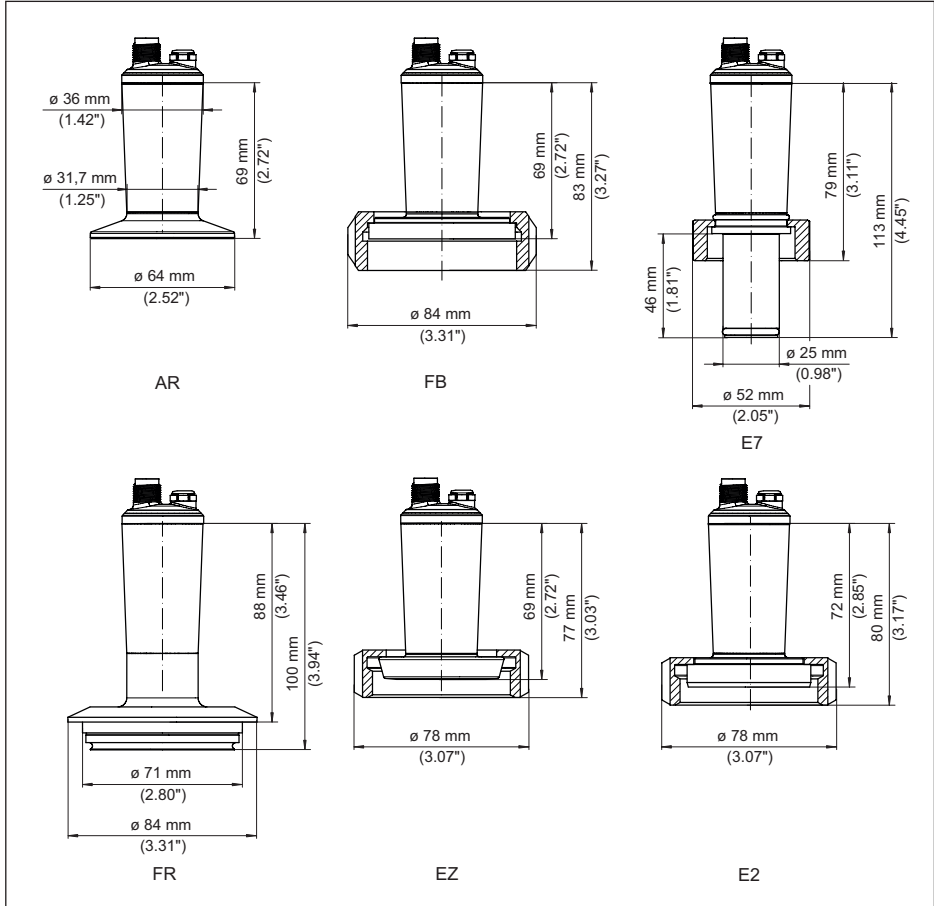


Fig. 30: VEGABAR 28, hygienic fitting

AR Clamp 2" PN 40, $\varnothing 64$ mm (DIN 32676, ISO 2852)

FB SMS DN 51 PN6

E7 Ingold connection PN 10

FR Varivent N50-40 PN 25, front-flush

EZ Collar socket DN 40 PN 40 (DIN 11851), front-flush

E2 Collar socket DN 40 PN 40 (DIN 11864-1, Form A)

13.4 Industrial property rights

VEGA product lines are global protected by industrial property rights. Further information see www.vega.com.

VEGA Produktfamilien sind weltweit geschützt durch gewerbliche Schutzrechte.

Nähere Informationen unter www.vega.com.

Les lignes de produits VEGA sont globalement protégées par des droits de propriété intellectuelle. Pour plus d'informations, on pourra se référer au site www.vega.com.

VEGA lineas de productos están protegidas por los derechos en el campo de la propiedad industrial. Para mayor información revise la pagina web www.vega.com.

Линии продукции фирмы ВЕГА защищаются по всему миру правами на интеллектуальную собственность. Дальнейшую информацию смотрите на сайте www.vega.com.

VEGA系列产品在全球享有知识产权保护。


进一步信息请参见网站 < www.vega.com。

13.5 Licensing information for open source software

Open source software components are also used in this device. A documentation of these components with the respective license type, the associated license texts, copyright notes and disclaimers can be found on our homepage.

13.6 Trademark

All the brands as well as trade and company names used are property of their lawful proprietor/originator.

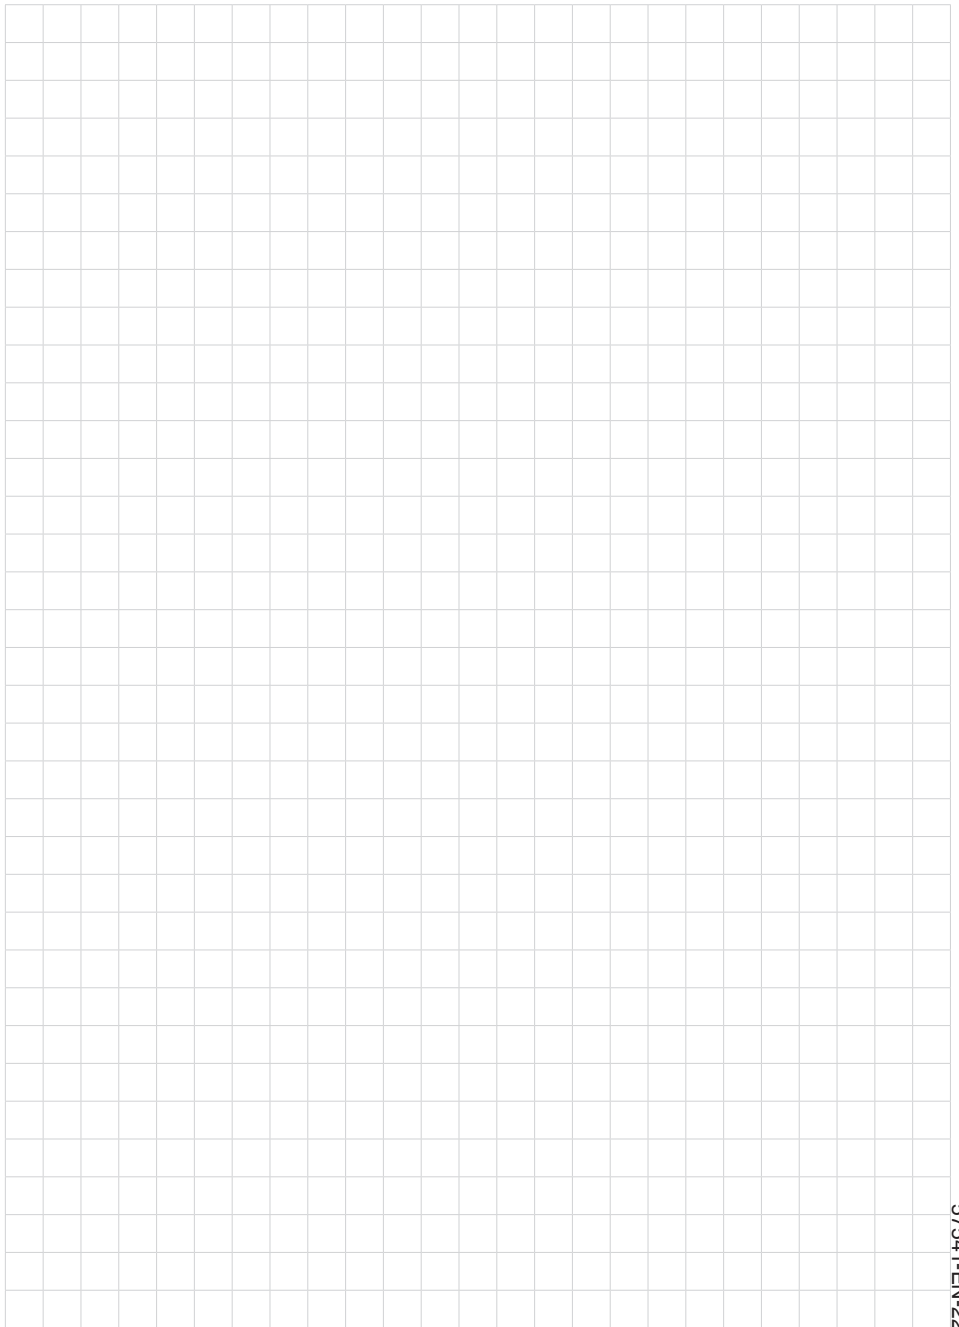

A large grid of graph paper for taking notes, consisting of 20 columns and 30 rows of small squares.

Printing date:

VEGA

All statements concerning scope of delivery, application, practical use and operating conditions of the sensors and processing systems correspond to the information available at the time of printing.

Subject to change without prior notice

© VEGA Grieshaber KG, Schiltach/Germany 2022



57541-EN-220826

VEGA Grieshaber KG
Am Hohenstein 113
77761 Schiltach
Germany

Phone +49 7836 50-0
E-mail: info.de@vega.com
www.vega.com